

SAILOR

Service Information No. 130
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato October 1989

Vedrørende Optuningsproblemer med SAILOR Program 1000/B Kortbølgesender T1130/T1135

Det har vist sig, at der ved enkelte sendere kan opstå problemer med optuningen, når VSWR-forholdet er dårligere en 1.4.

Årsagen til dette er, at Invalid Tuning knappen (S304 i T1130/T1135) bliver aktiveret, når luftfiltret monteres.

Problemet afhjælpes ved at halvere tykkelsen af filtermåtten ud for knappen.

Regarding Uptuning Problems with SAILOR Programme 1000/B Short Wave Transmitter T1130/T1135

You may run into problems with some transmitters in connection with uptuning when the VSWR-condition is worse than 1.4.

The reason is that the Invalid Tuning button (S304 in T1130/T1135) is activated when the air filter is mounted.

The problem can be solved by a halving of the filter mat in front of the button.



Please file this information in the service-portfolio we have sent you.


Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

Å/S **S. P. RADIO**
Aalborg - Denmark

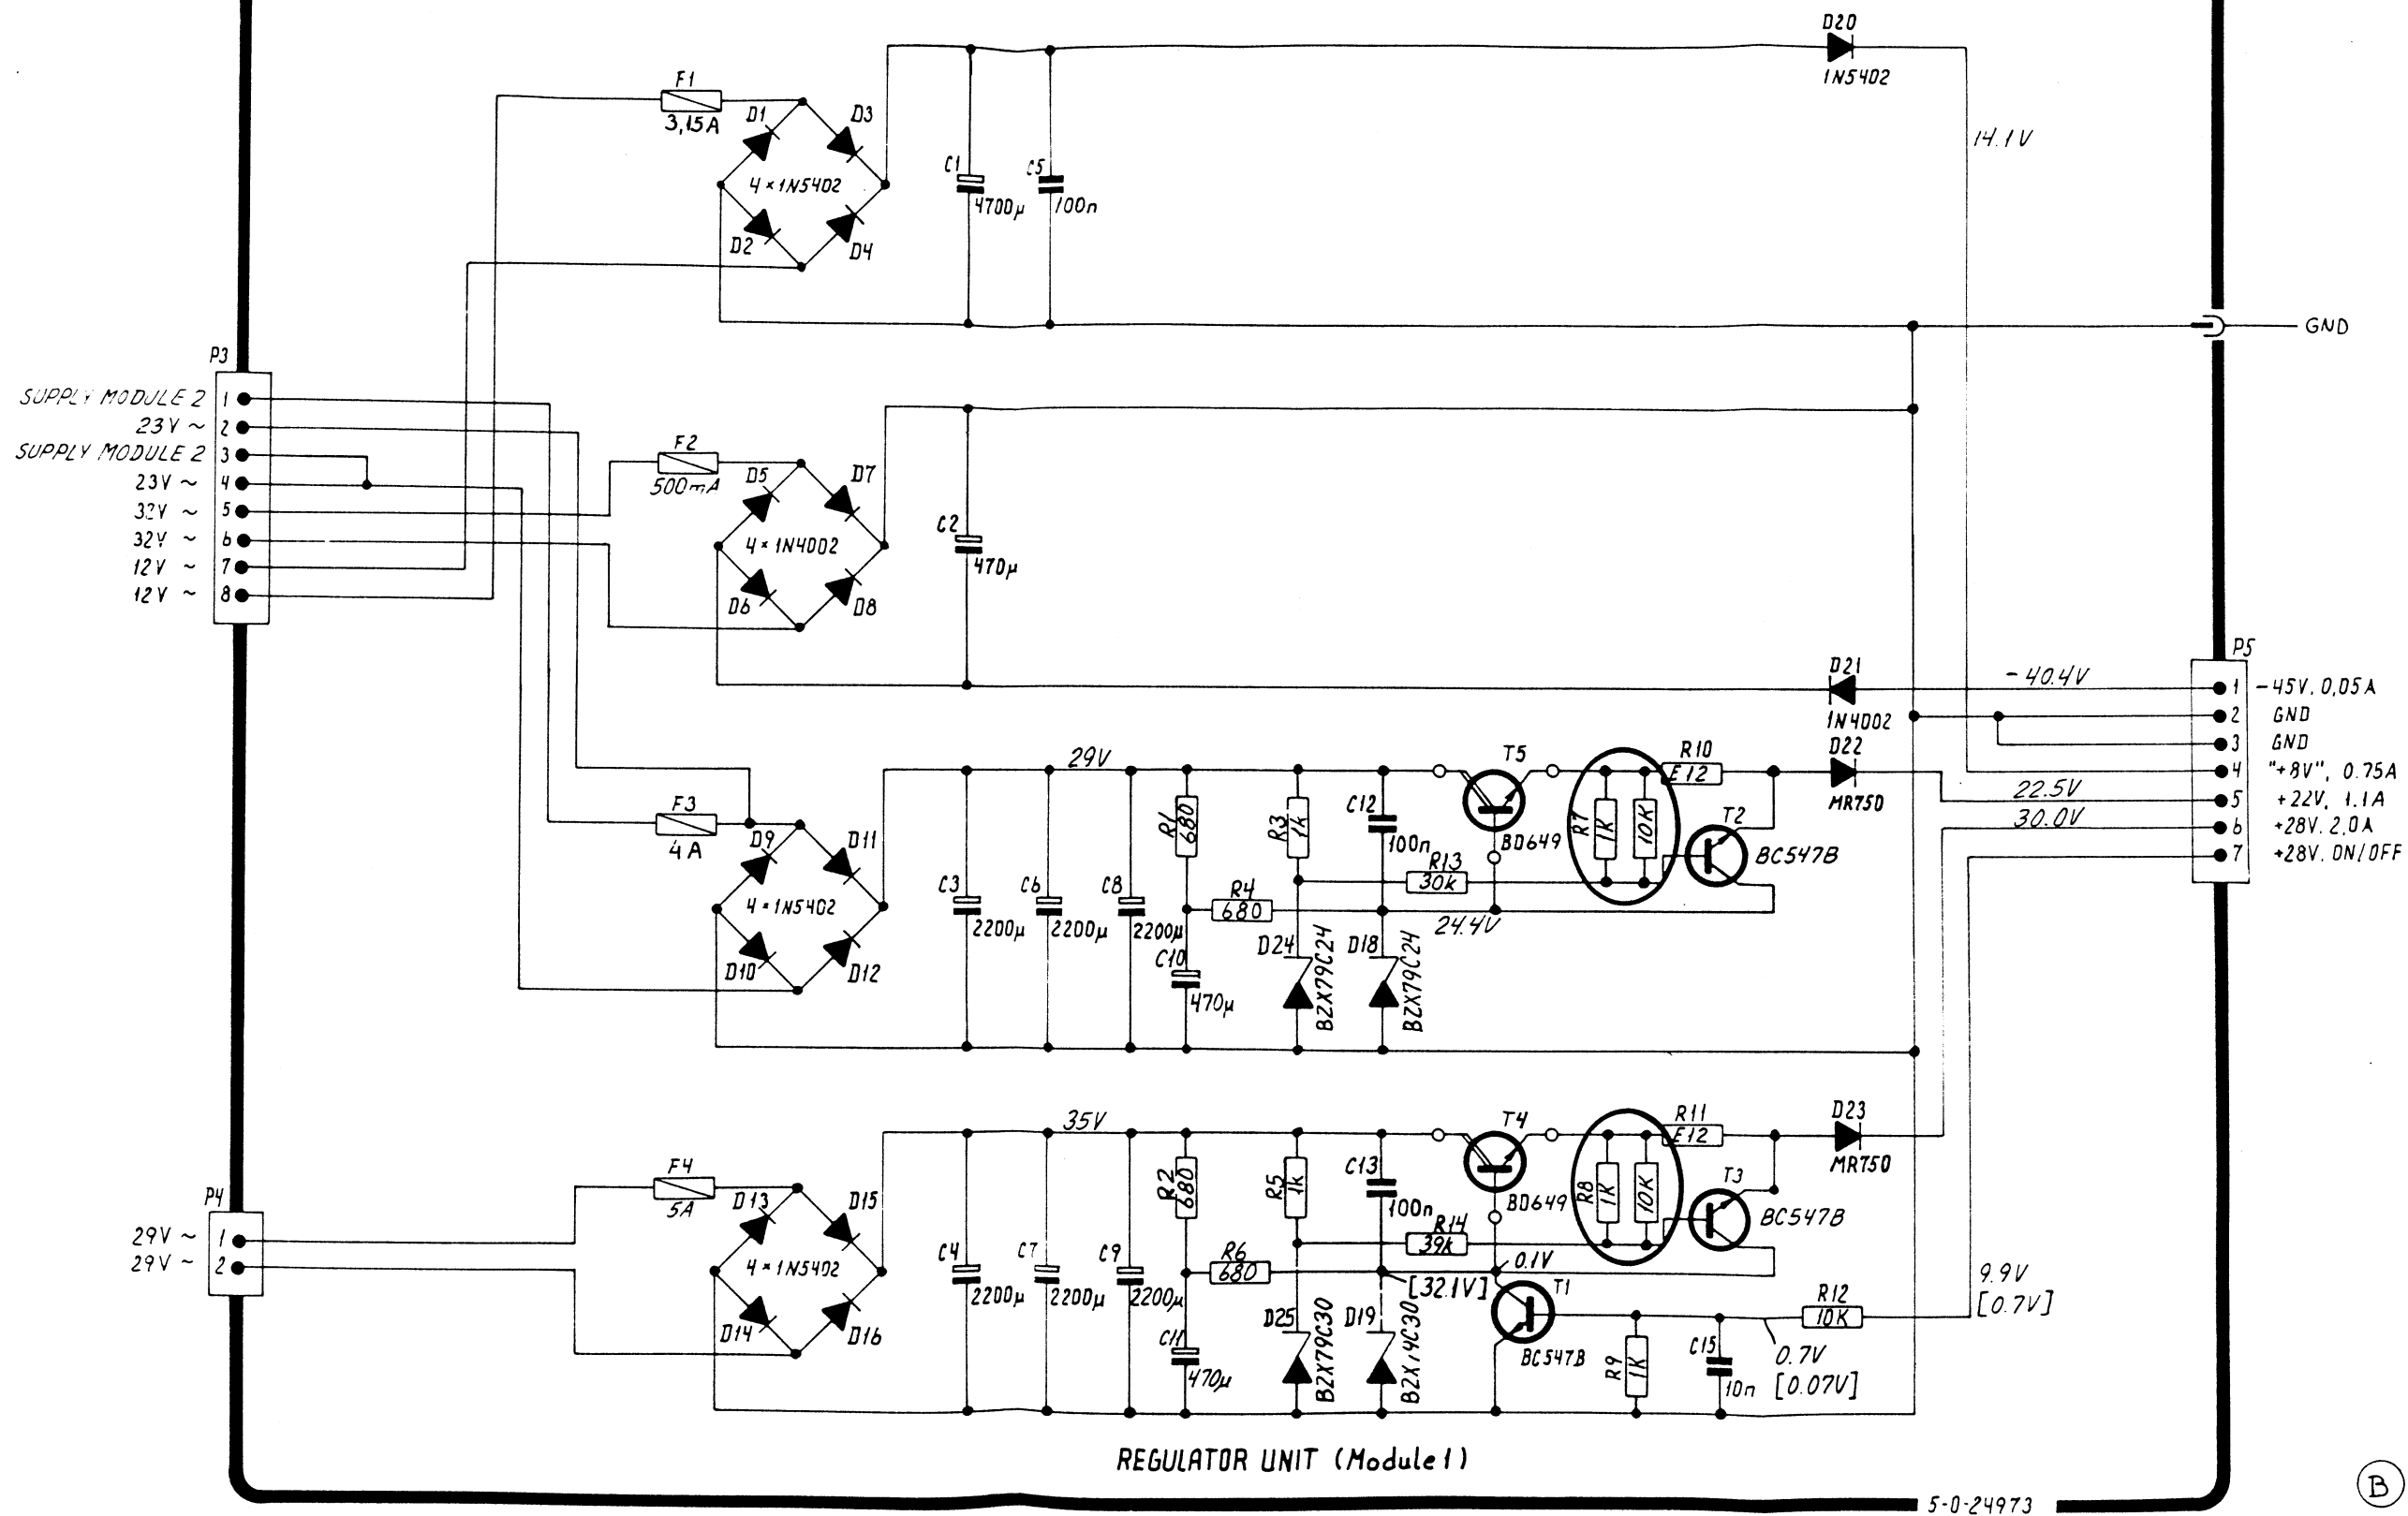

Test conditions:

Voltage without brackets meter input impedance 10 Mohm.

Voltage in brackets [] circuit is activated.