

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato December 1979

CONC. REMOTE CONTROL H1200


Much to our regret it has turned out that some of these units have been delivered with a fault that has not been detected by our final control.

The fault is that the distance piece marked * on the drawing has been manufactured with an outside diameter of 5.5 mm instead of $\phi 5.4^{+0}_{-0.2}$ mm, which is correct.

The effect is that the distance piece is working very tightly in the slit of the TUNE shaft, which might under unfortunate circumstances result in an overload of the shaft of the motor.

Remedy the fault as follows:

1. Remove motor (see page 11 in the instruction manual for T1127).
2. Replace distance piece marked * by the enclosed correct distance piece.
3. Mount motor unit as described on page 11 in the instruction manual for T1127.
4. Test the transmitter.

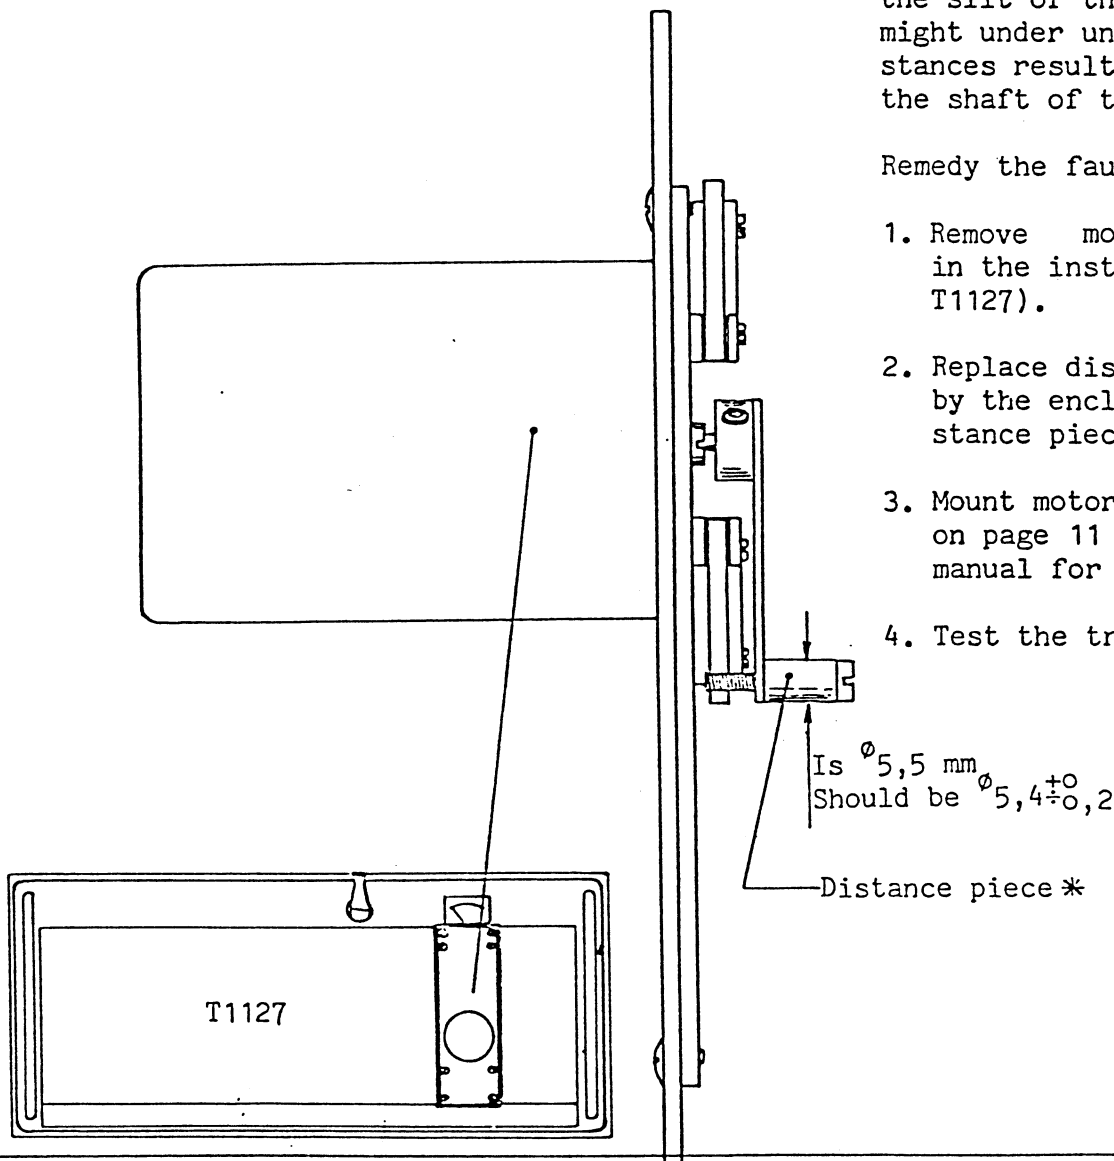

Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.



S. P. RADIC

Aalborg - Denmark