

SAILOR

86

Service Information No.
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato

September, 1983

SAILOR SHORT WAVE PROGRAMME 1000
=====

For radiotelex operation of our R1119, R1120 and T1127, S1301 (or S1300TT) the receiver post-mute (or RX-delay) generated at the A2H OSC and DELAY-UNIT (1800) has been found to be too long.

If the receiver post-mute (or RX-delay) is too long it may cause problems with the communication in ARQ-mode when the two stations are too close to each other.

The receiver post-mute (or RX-delay) has been changed from 18 msec. to 10 msec. by changing the resistor R1820 on A2H OSC and DELAY-UNIT (1800) from 56 kohm to 15 kohm (and adjusted with R1819).

This modification has been carried out on the exciters from serial No. 269815 on S1301.



Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

S. P. RADIO

Aalborg - Denmark