

INSTRUCTION MANUAL
FOR
REGULATED POWER SUPPLIES

LQ-530 SERIES

This manual provides instructions intended for the operation of Lambda power supplies, and is not to be reproduced without the written consent of Lambda Electronics. All information contained herein applies to all LQ 530 series models unless otherwise specified.

LAMBDA ELECTRONICS

MAIN PLANT TELEPHONE: (516) 694-4200

MELVILLE, L.I., N.Y.

IM-LQ 530

TABLE OF CONTENTS

Section	Page
SPECIFICATIONS AND FEATURES	1
OPERATING INSTRUCTIONS	4
Controls, Instruments, and Fuses	4
Ground Connections	5
Basic Modes of Operation	5
Supply — Load Connections	5
Detailed Operating Procedures	7
Operation After Protective Device Shutdown	13
MAINTENANCE	13
General	13
Trouble Analysis	13
Checking Transistors and Capacitors	13
Printed Circuit Board Maintenance Techniques	14
Complete Power Supply Calibration Procedures	14
Adjustment of Voltage Calibration Control R102	14
Adjustment of Current Calibration Control R111	15
Adjustment of Current Calibration Control R104	15
Adjustment of Voltmeter Calibration Control R213	16
Adjustment of Meter Reference Calibration Control R304	16
Adjustment of Ammeter Calibration Control R242	17
Performance Checks	17
SERVICE	18
PARTS ORDERING	18
USE OF RACK ADAPTERS (Fig. 15)	
Installation of ½ Rack Units into LRA-1 (Fig. 15)	
Shipment of Units Mounted in LRA-1 (Fig. 15)	
Mounting Chassis Slides (Fig. 15)	
Using Blank Panels and Blank Chassis (Fig. 15)	

SPECIFICATIONS AND FEATURES

Specifications apply for all models

DC OUTPUT AND RATINGS — Voltage and current regulated for line and load. Refer to the following tables and fig. A.

Voltage Range

TABLE I
VOLTAGE RANGE

MODEL	LQ 530	LQ 531	LQ 532	LQ 533	LQ 534
Voltage Range VDC*	0-10	0-20	0-40	0-60	0-120

Multi-Current Ranges Current range must be chosen to suit the appropriate maximum ambient temperature.

*With external programming. Front panel voltage control allows adjustment over a range of 1% V_o max to V_o max.

TABLE II
MAX. CURRENT (AMPS)

MODEL	MAXIMUM CURRENT AT AMBIENT OF:							
	30° C		40° C		50° C		60° C	
	At Vmax	At Vmin	At V max	At Vmin	At Vmax	At Vmin	At Vmax	At Vmin
LQ 530	14.0	10.0	12.7	9.0	11.0	8.0	9.2	7.2
LQ 531	8.6	6.0	8.6	5.6	7.4	5.1	6.4	4.6
LQ 532	5.0	3.5	5.0	3.3	4.5	3.0	3.9	2.7
LQ 533	3.3	2.4	3.3	2.3	3.0	2.1	2.5	1.9
LQ 534	1.7	1.2	1.7	1.1	1.6	1.0	1.5	0.9

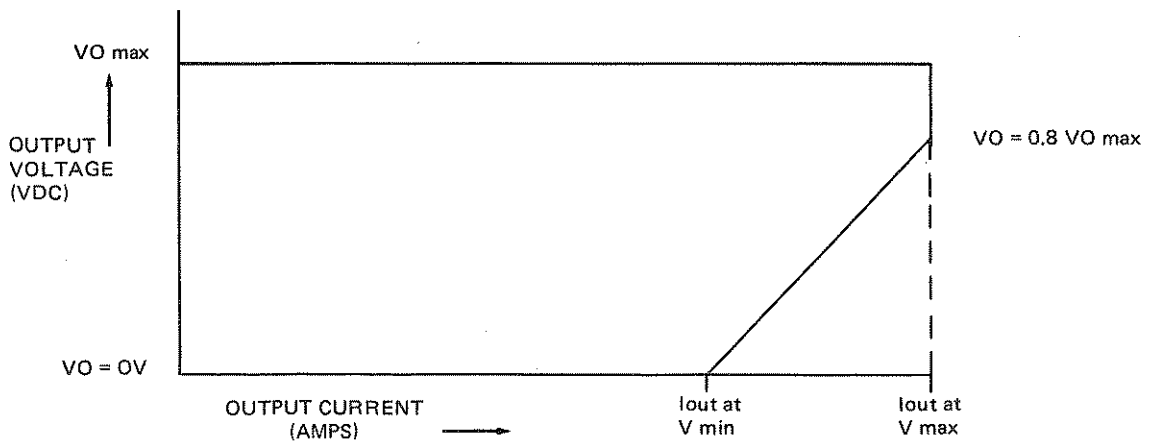


Figure A. Output Characteristics

REGULATED VOLTAGE OUTPUT

Regulation (line)	0.005 per cent plus 0.5 millivolt for input variations from 105-132 or 132-105 volts AC.
Regulation (load)	0.005 percent plus 0.5 millivolt for load variations from no load to full load or full load to no load.
Remote Programming	
External Resistor	Nominal 1000 ohms/volt output. (Refer to page 6 for details.)
Programming Voltage	One-to-one voltage change.
Ripple and Noise	150 microvolts rms; 1.0 millivolt peak-to-peak with either positive or negative terminal grounded.
Temperature Coefficient	Output change in voltage less than $(0.005\% V_o + 10\mu V)/^{\circ}C$ (with external programming resistors).
Remote Sensing	Provision is made for remote sensing to eliminate effect of power output lead resistance on DC regulation.
Series/Parallel operation	Provision is made for auto series/auto parallel (master-slave) operation to permit tracking to a common reference.

REGULATED CURRENT OUTPUT: AUTOMATIC CROSSOVER

Current range	1% to approximately 70% of full rated load current (refer to fig. A).
Regulation (line)	1 ma max for line variations from 105-132 or 132-105 volts AC.
Regulation (load)	2.5 ma max for load changes from 0 to rated DC voltage or rated DC voltage to 0.

AC INPUT — 105-132 volts AC @ 47-440 Hz. For 47-53 Hz operation, derate output by 10%. For 63-440 Hz operation, consult factory. Input power: 425 watts maximum*. Input current: 5A RMS maximum*.

*With output loaded to full current rating, maximum rated output voltage, input voltage 132 VAC at 60 Hz.

OVERLOAD PROTECTION

Thermal	Thermostat, resets automatically when over-temperature condition is eliminated.
Electrical	
External	Adjustable, automatic, electronic current-limiting circuit, settable to 105 percent of rated current, limits output current to preset limit for protection of load and power supply when external overloads and direct shorts occur.
Internal	“SLO-BLO”, 7A fuse F1 protects the AC input circuit. Overload of the supply does not cause fuse failure.
	Fuse F2 provides protection against internal circuit failure in conjunction with overvoltage protector option.

INPUT AND OUTPUT CONNECTIONS — Heavy duty terminal block on rear of chassis with 5-foot, 3 wire detachable line cord for all models except V and V1 option units, which have an AC receptacle in place of the 3-wire line cord and the AC input terminals on the terminal block that are used for the AC input connection on standard AC input units; five-way binding posts provide for additional positive (+) ground, and negative (–) DC output connections on front panel.

OVERSHOOT — No overshoot of output voltage under conditions of power turn-on, power turn-off or power failure.

OPERATING AMBIENT TEMPERATURE RANGE AND DUTY CYCLE — Continuous duty from 0° C to 60° C ambient with corresponding load current ratings for all modes of operation.

STORAGE TEMPERATURE — (non-operating) -55° C to +85° C

COOLING — Convection cooled; no fans or blowers.

METERING — Digital panel meter monitors output voltage or load current as selected by **METER SELECTION** switch.

FUNGUS — All LQ series power supplies are fungus inert.

CONTROLS

- Power Panel mounted switch for all units.
- Meter Selector Selects meter function. Either output voltage or current can be monitored; located on front panel of all models.
- DC Output Coarse and fine voltage controls on LQ 530 and LQ 531 (single ten turn voltage control for LQ-532 thru LQ-534) and coarse current control permit adjustment of DC output; located on front panel of all models. Front panel voltage control allows adjustment over a range of 1% V_o max to V_o max.
- Binding posts (+) (-) (GND) Five-way binding posts on front panel of all models.

PHYSICAL DATA

- Size 5-3/16" H x 8-3/8" W x 15-3/16" D
- Weight 25 lbs. net, 30 lbs. shipping
- Panel Finish Charcoal brown (standard); special finishes available to customer specifications at moderate surcharge.

AC INPUT OPTION

V-V1 option. Standard LQ power supplies can be obtained for 187-242 VAC ("V") input or 205-265 VAC ("V1") input. See nameplate for AC input rating.

MOUNTING

- Laboratory bench, table top Bumpers secured to the base of all units permit proper circulation of air through the unit. Removal of bumpers will restrict free-flow of air; avoid removing bumpers. Retractable bench rest on bottom of unit is provided as an aid in viewing output meters.
- Standard 19" Rack All units can be used with rack adapters: LRA-1 (slide accommodation provided) LRA-2 (conventional mount)

ACCESSORIES

- Rack Adapters Rack adapter LRA-1, with or without chassis slides is available as well as rack adapter LRA-2 which is used for simple rack installations where chassis slides are not required. See figure 15.
- Blank Panels Half-rack panels can be used with the Lambda rack adapters, see figure 15.
- Overvoltage Protector Externally mounted. Overvoltage Protectors LHOV-4, LHOV-5, and LHOV-6 are available for use with LQ power supplies LQ530, LQ531, LQ532 and LQ533.
- Pot Cover Lambda pot cover PC-1, consisting of a lock nut and a black anodized knurled knob, is tamper proof and fits standard potentiometer shaft threads.

OPERATING INSTRUCTIONS

CONTROLS, INSTRUMENTS, AND FUSES

Power ON—OFF Switch. The power ON-OFF switch, located on the front panel, controls application of input power to the supply. When the switch is in the ON position, the digital panel meter will be illuminated.

OUTPUT VOLTAGE Control. The OUTPUT VOLTAGE control is a dual control consisting of a course adjustment potentiometer, which varies the DC voltage over a range of 0.1-9, 0.2-19, volts as applicable, and a fine adjustment potentiometer, which varies the DC voltage over a one-volt range**. Clockwise rotation results in increasing voltage. The total DC voltage output for voltage regulated operation is equal to the sum of each shaft setting; for current regulated operation the maximum voltage limit is equal to the sum of each shaft setting. The control is located on the front panel of all units.

**On models LQ532 thru LQ534 the DC OUTPUT VOLTAGE control is a single ten turn control, which varies the DC voltage over a range of 1% V_o max to V_o max.

CURRENT LIMITER Control. The CURRENT LIMITER control varies the DC current over the rated current range. Clockwise rotation results in increasing current. The control is located on the front panel of all units.

Digital Panel Meter. A digital meter monitors output voltage or current over rated range. Display illuminates when ON-OFF switch is in "ON" position. Display flashes when meter is overloaded. Meter accuracy is 5%, \pm two counts. Note that the sensing divider current flows through the meter, consequently the ammeter will indicate the sum of the load current plus the sensing divider current.

METER SELECTOR Switch. Selects meter function. Either output voltage or load current can be monitored.

Fuses. Fuse F1, internally located, is a 7 ampere, 3AG "SLO-BLO" fuse which functions in the AC input circuit.

Fuse F2, internally located, provides protection against internal circuit failure. See schematic diagrams for current ratings of pertinent F2 fuse.

Connection Terminals. Make all connections to the supply at the terminal block on the rear of the supply. DC output connections can also be made at the five-way binding posts located on the front panel. Apply input power through the line cord or directly to terminals 1 and 2 if the line cord is removed. Always connect the ungrounded (hot) power lead to terminal 1.

The supply positive terminal is brought out to terminal 6. The supply negative terminal is brought out to terminal 4. Recommended wiring of the power supply to the load and selection of wiring is shown in figures 1 through 10. Selection of proper wiring is made on the basis of load requirements. Make all performance checks and measurements of current or voltage at the rear output terminals. Connect measuring devices to sense terminals or use the shortest leads possible.

GROUND CONNECTIONS

The Lambda power supply can be operated either with negative or positive output terminal grounded or with no terminal grounded. Both positive and negative ground connections are shown in the diagrams for all suggested output connections illustrated in this manual.

NOTE: When operating the supply with neither terminal grounded high impedance leakage resistance and capacitance paths can exist between the power supply circuitry and chassis ground.

BASIC MODES OF OPERATION

This power supply is designed to operate as a constant voltage source or as a constant current source. Automatic crossover to either mode of operation occurs when load conditions change as follows:

Constant Voltage. The power supply will function as a constant voltage source while the load current does not equal the current value, I_{LIM} , set by the CURRENT LIMITER control. When load current $I_L = V/R_L = I_{LIM}$, the supply will cross over automatically and will operate as a constant current source. Further decrease in value of load resistance R_L results in a decrease of voltage across the load while current remains regulated to I_{LIM} .

Constant Current (Automatic Crossover). The power supply will function as a constant current source while the load voltage V_L does not equal the voltage value set by the OUTPUT VOLTAGE control. When load voltage V_L equals the value set by the OUTPUT VOLTAGE control, the supply will automatically cross over and operate as a constant voltage source.

SUPPLY — LOAD CONNECTIONS

NOTE: Refer to DETAILED OPERATING PROCEDURES for step-by-step instructions for operation of power supply.

CONNECTIONS FOR OPERATION AS A CONSTANT VOLTAGE SOURCE

The output impedance and regulation of the power supply at the load may change when using the supply as a constant voltage source and connecting leads of practical length are used. To minimize the effect of the output leads on these characteristics, remote sensing is used. Recommended types of supply load connections with local or remote sensing are described in the following paragraphs.

Refer to figure 1 to determine voltage drop for particular cable length, wire size and current conditions. Lead lengths must be measured from supply terminals to load terminals as shown in figure 2.

Two-Wire Connection, Figure 3. The two-wire connection, with local sensing, is the connection suitable for application with relatively constant load where extremely close load regulation over full-rated current excursion is *not* required at the load.

Four-Wire Connection, Figure 4. The four-wire connection with remote sensing, provides complete compensation for the DC voltage drops in the connecting cables. A 2MF, 35V capacitor may be required to reduce noise, between terminals 3, 4, and 6, 7 whenever remote sensing is used. +S and -S sensing leads must be twisted together.

Programmed Voltage Connections, Using External Resistor, Figure 5. Discrete voltage steps can be programmed with a resistance voltage divider valued at 1000 ohms/volt output and a shorting-type switch as shown in figure 5. When continuous voltage variations are required, use variable resistor with the same 1000 ohms/volt ratio in place of the resistive voltage divider and shorting-type switch. Use a low temperature coefficient resistor to assure most stable operation. When resistively programming downward to voltages less than 1 volt, programming must be accomplished in two steps; first, from original value to 1 volt, and then from 1 volt to final desired value.

As shown in figure 5, voltages can be programmed utilizing either local or remote sensing connections, as desired.

Programmed Voltage Connections Using Programming Voltage, Figure 6. The power supply voltage output can be programmed with an externally connected programming power supply.

The output voltage of the programmed supply will maintain a one-to-one ratio with the voltage of the programming supply.

CONNECTIONS FOR OPERATION AS A CONSTANT CURRENT SOURCE

Automatic Crossover Constant Current Connections, Figure 3. Figure 3 shows the connections which are used when operating the power supply as a constant current source with automatic crossover, using local setting of current control*.

*Setting control for output currents below rated limits can result in no output or no regulation.

In this mode of operation, when the load voltage increases to the limit of the OUTPUT VOLTAGE control setting, due to changing load resistance, the power supply crossover circuit will cause the unit to operate as a constant voltage supply.

CONNECTIONS FOR SERIES OPERATION

The voltage capability of LQ power supplies can be extended by series operation of two LQ power supplies of equal* voltage ratings. A maximum of 300 volts can be connected between either the +DC or -DC terminal and chassis ground, and a maximum voltage capability of 240 volts is possible for model LQ534.

*For applications using supplies of unequal ratings, consult factory for details of operation.

The two units are shown connected for series operation in figures 7 and 8. Figure 7 shows the series connection diagram which would be suitable for use in all applications where exact one-to-one voltage tracking of the "master" (M) unit by the "slave" (S) unit is not required. The slight offset in tracking is easily compensated for by adjusting the OUTPUT VOLTAGE controls on the (S) unit.

Figure 8 shows the series connection diagram suitable for applications where exact one-to-one voltage tracking is required. In this series configuration, resistor R_{BAL} permits the (S) unit to track the (M) unit on an exact one-to-one basis, thereby eliminating the possibility of an offset voltage existing between the two units.

Resistor R_{BAL} should be a two-watt, 10 ohm/volt output, resistor. This value would permit wide-range compensation for manufacturing differences inherent in the components used in each unit. Resistors R_S and R_M function in the voltage sensing circuits of both units, enabling the (S) unit to reference its output voltage of that of the (M) unit. In figure 7, R_M performs a similar function. Capacitor C_S , used to eliminate stray AC pickup, is rated at 2.5 mfd, 250 V.

For either series mode of operation, select R_S and R_M on the basis of 1000 ohms per volt of (M) unit output voltage. R_S must equal R_M . Choose R_S and R_M to be low temperature coefficient resistors.

Diodes CR_M and CR_S , which protect the units against reverse voltage must be capable of withstanding the maximum rated current of the (M) unit, and must have a reverse blocking voltage equal to 2.5 times the maximum rated output voltage.

Both methods permit operation for either constant voltage or constant current with automatic crossover to either mode of operation whenever the respective limiting operating current or voltage is reached. As shown in figures 7 and 8, each method permits connection for either local or remote sensing.

CONNECTIONS FOR PARALLEL OPERATION

The current capability of LQ power supplies can be extended by parallel operation of two LQ power supplies of equal* voltage capacities. The two units are shown connected for parallel operation in figures 9 and 10. One power supply designated the "master" or (M) unit controls its own output as well as the output of the second power supply, designated the "slave" or (S) unit.

*For applications using supplies of unequal voltage ratings, consult factory for details of operation.

Unit (S) operates to regulate its current to be equal to that of the (M) unit by comparing the current in its internal sampling resistor with that current sampled by the master internal sampling resistor.

Parallel connected units can be operated for constant voltage with local sensing, figure 9, or remote sensing, figure 10, as well as for constant current with automatic crossover, figure 9. When operating for constant voltage, the (M) unit can automatically cross over into constant current operation.

DETAILED OPERATING PROCEDURES

SAFETY NOTICE

DANGEROUS VOLTAGES EXIST IN THIS EQUIPMENT. OBSERVE THE USUAL SAFETY PRECAUTIONS WHEN OPERATING OR SERVICING THE EQUIPMENT TO AVOID SHOCK OR INJURY.

CONSTANT VOLTAGE OPERATION, ADJUSTABLE CURRENT LIMIT

1. Apply AC power to the supply but place power ON-OFF switch in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size from figure 1 and 2, and choose desired type of supply-load connection from figure 3 and 4. Do not connect load.
3. Place power ON-OFF switch in ON position and check that digital panel meter illuminates.
4. Set CURRENT LIMITER control fully CW and adjust OUTPUT VOLTAGE control knobs to obtain desired voltage indication. When the current to the load must be limited to an intermediate value within the current rating of the supply, proceed as follows: a) place power ON-OFF switch in OFF position, b) connect jumper between +V and -V terminals, c) place power ON-OFF switch in ON position, place METER SELECTION switch in AMPS position, and adjust CURRENT LIMITER control to obtain the desired meter indication, d) place power ON-OFF switch in OFF position and remove jumper.
5. Connect supply to load as shown on selected connection diagram.
6. Place power ON-OFF switch in ON position and check that digital panel meter illuminates.

7. Check that digital panel meter indicates desired values; as required, adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control to obtain correct meter indications.
8. Power supply is now in proper operation.

PROGRAMMED CONSTANT VOLTAGE OPERATION, ADJUSTABLE CURRENT LIMIT

1. Apply AC power to the supply, but place power ON-OFF switch in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size and length from figures 1 and 2, and choose desired type of supply load connections from figures 5 and 6. Refer to paragraph on Programmed Voltage Connections.
3. Connect supply terminals as shown on the selected connection diagram. As shown in figure 5, take care to use a shorting-type switch for the external programming control when several voltages are desired and the programming voltage method is not used. Do not connect load. Note that when resistively programming downward to voltages less than 1 volt, programming must be accomplished in two steps; first, from original value to 1 volt, and then from 1 volt to final desired value.
4. When current to the load must be limited to an intermediate value within the current rating of the supply, proceed as follows:
 - (a) Connect jumper between +V and -V terminals.
 - (b) Place power ON-OFF switch in ON position and adjust CURRENT LIMITER control to obtain the desired current limit meter indication.
 - (c) Place power ON-OFF switch in OFF position and remove jumper between +V and -V terminals.
5. Connect Supply to load as shown on the selected connection diagram.
6. Place power ON-OFF switch in ON position and check that digital panel meter illuminates.
7. Check that digital panel meter indicates desired values; as required, adjust CURRENT LIMITER knob and external programming voltage control to obtain correct meter indications.
8. Power supply is now operating properly.

CONSTANT CURRENT OPERATION WITH CROSSOVER, ADJUSTABLE VOLTAGE LIMIT

1. Apply AC power to the supply, but place power ON-OFF switch in OFF position.

NOTE: When shipped from factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size from figures 1 and 2 and connect supply terminals as shown in figure 3. Do not connect load.
3. Adjust CURRENT LIMIT control to the desired output current as follows:
 - (a) Connect jumper between +V and -V terminals.
 - (b) Place power ON-OFF switch in ON position, METER SELECTION switch in AMPS position, and adjust CURRENT LIMITER control to obtain the desired load current as indicated on current meter.
 - (c) Place power ON-OFF switch in OFF position and remove jumper between +V and -V terminals.
4. Place power ON-OFF switch in ON position, METER SELECTION switch in VOLTS position, and adjust OUTPUT VOLTAGE control knobs to obtain the desired voltage limit point as indicated on voltage meter.
5. Place power ON-OFF switch in OFF position and connect load to the supply as shown in figure 3.
6. Place power ON-OFF switch in ON position and check that digital panel meter illuminates.
7. Check that digital panel meter indicates desired values; adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control as required to obtain correct indications.
8. Power supply is now in proper operation.

***SERIES CONNECTION CONSTANT VOLTAGE OPERATION, WITH CURRENT LIMIT**

1. Apply AC power input to the "slave" (S) and "master" (M) units, and place power ON-OFF switches in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size from figures 1 and 2, and choose correct type of series supply-load connections from figures 7 and 8. Refer to paragraph on CONNECTIONS FOR SERIES OPERATION.
3. Connect power supply terminals as shown on the selected connection diagram. As required, select resistors R_{BAL} , R_S , and R_M and diodes CR_S and CR_M in accordance with instructions contained in CONNECTIONS FOR SERIES OPERATION. Do not connect load.
4. **Place power ON-OFF switches in ON position, place METER SELECTION switch in VOLTS position, and adjust OUTPUT VOLTAGE control knobs on the (M) unit to obtain the desired meter indication. Adjust (S) unit OUTPUT VOLTAGE controls until (S) unit voltage meter indication equals (M) unit voltage meter indication. This setting will be approximately one-half of the combined (M) and (S) unit output voltage. The (S) unit will track any change in (M) unit output voltage made with the (M) unit OUTPUT VOLTAGE control. Place power ON-OFF switch in OFF position.

*Applies only to units of equal voltage and current capacities, when units of unequal ratings are series connected, consult factory.

**This step does not apply to figure 8.

5. When current to the load must be limited to an intermediate value within the current rating of each supply, proceed as follows:
 - (a) Connect jumper between +V and -V terminals on the (M) unit.
 - (b) Place power ON-OFF switch in ON position, place meter selector switch in AMPS position, and adjust CURRENT LIMITER control on the (M) unit to the desired current limit point, as indicated on digital panel meter.
 - (c) Set CURRENT LIMITER control on (S) unit slightly above CURRENT LIMITER control setting on (M) unit.
 - (d) Place power ON-OFF switch in OFF position and remove jumpers between +V and -V terminals.
6. Connect supplies to load as shown on the selected connection diagram.
7. Place power ON-OFF switches in ON position and check that digital panel meter illuminates.
8. Check that digital panel meter* indicates desired values; adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control as required to obtain correct indications.

*Ammeter indicates a nominal 1 to 2 milliamperes offset from zero, which is the sensing divider current and not load current. For load current use the 1 to 2 ma. point as zero point.
9. Power supplies are now in proper operation.

SERIES CONNECTION CONSTANT CURRENT OPERATION, WITH VOLTAGE LIMIT

1. Apply AC power input to the "slave" (S) and "master" (M) units and place power ON-OFF switches in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.
2. Determine load requirements, select wire size from figures 1 and 2 and choose correct type of series supply-load connections from 7A and 8A. Refer to paragraph on CONNECTIONS FOR SERIES OPERATION.
3. Connect power supply terminals as shown on the selected connection diagram. As required, select resistors R_{BAL} , R_S , and R_M and diodes CR_S and CR_M as instructed in CONNECTIONS FOR SERIES OPERATION. Do not connect load.
4. Place power ON-OFF switches in ON position, and METER SELECTION switch in VOLTS position.
5. Adjust (S) unit OUTPUT VOLTAGE controls until (S) unit voltage meter indication equals (M) unit voltage meter indication. The (S) unit will track any change in (M) unit output voltage made with the (M) unit OUTPUT VOLTAGE control.

6. When the voltage to the load must be limited to an intermediate value within the voltage rating of the series combination, proceed as follows:
 - (a) Place power ON-OFF switch of the (M) unit in ON position.
 - (b) Turn the (M) unit OUTPUT VOLTAGE control knobs until voltage meter indicates approximately one-half the total rating desired for the series combination.
 - (c) Place power ON-OFF switch in OFF position.
7. Adjust CURRENT LIMITER control for the desired load current as follows:
 - (a) Connect jumper between +V and -V terminals on (M) unit.
 - (b) Place power ON-OFF switch in ON position, METER SELECTION switch in AMPS position, and adjust CURRENT LIMITER control to the desired load current as indicated on (M) unit digital panel meter.
 - (c) Set CURRENT LIMITER control on (S) unit slightly above CURRENT LIMITER control setting on (M) unit.
 - (d) Place power ON-OFF switch in OFF position and remove jumpers between +V and -V terminals.
8. Connect supplies to load as shown on the selected connection diagram.
9. Place power ON-OFF switches in ON position and check that digital panel meter illuminates.
10. Check that digital panel meter* indicates desired values; adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control as required to obtain correct indications.

*Ammeter indicates a nominal 1 to 2 milliamperes offset from zero, which is the sensing divider current and not load current. For load current use the 1 to 2 ma. point as zero point.
11. Power supplies are now in proper operation.

PARALLEL CONNECTION CONSTANT VOLTAGE OPERATION, WITH CURRENT LIMIT

1. Apply AC power input to the "slave" (S) and "master" (M) units and place power ON-OFF switches in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size from figures 1 and 2 and choose correct type of parallel supply-load connections from figures 9 and 10. Connect supply terminals as shown on the selected connection diagram, but do not connect load.
3. Place power ON-OFF switches of both (M) and (S) units in ON position, and METER SELECTION switch in VOLTS position.
4. Turn (M) and (S) unit CURRENT LIMITER controls fully CW.
5. Adjust (M) unit OUTPUT VOLTAGE control for the desired voltage as read on (M) unit digital panel meter.

6. Place power ON-OFF switches of both units in OFF position.
7. When current to the load must be limited to an intermediate value within the current rating of each supply, proceed as follows:
 - (a) Connect supply to the load and place a jumper across load terminals.
 - (b) Place power ON-OFF switches in ON position, place METER SELECTION switches in AMPS position, and adjust (M) unit CURRENT LIMITER control for desired meter reading. The short circuit current will be the sum of (M) & (S) unit meter readings.
 - (c) Place power ON-OFF switches in OFF position and remove jumper across load.
8. Place power ON-OFF switches in ON position and check that digital panel meters illuminate.
9. Check that digital panel meter* indicates desired values; adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control as required to obtain correction indications.

*Ammeter indicates a nominal 1 to 2 milliamperes offset from zero, which is the sensing divider current and not load current. For load current use the 1 to 2 ma. point as zero point.
10. Power supplies are now in proper operation.

PARALLEL CONNECTION CONSTANT CURRENT OPERATION, WITH VOLTAGE LIMIT

1. Apply AC power input to the "slave" (S) and "master" (M) units and place power ON-OFF switches in OFF position.

NOTE: When shipped from the factory, the supply is ready for use as a constant current source with automatic crossover or as a local-sensing constant voltage source. Jumpers are connected at the factory as shown in figure 3. Take care to remove the appropriate jumpers for load requirements that need different supply-load connections. Refer to the appropriate connection diagram. When the five way binding posts are used, do not remove barrier strip jumpers.

2. Determine load requirements, select wire size from figures 1 and 2, and choose type of parallel supply-load connections from figure 9. Connect supply terminals as shown on the selected connection diagram, but do not connect load.
3. Place power ON-OFF switches of both (M) and (S) units in ON position, and METER SELECTION switches in VOLTS position.
4. Turn (S) unit current limiter control fully CW.
5. Adjust (M) unit OUTPUT VOLTAGE control for the desired voltage limit point as read on (M) unit digital panel meter.
6. Place power ON-OFF switches of both units in OFF position.
7. Set the desired load current as follows:
 - (a) Connect supply to the load and place a jumper across load terminals.
 - (b) Place power ON-OFF switches in ON position, place METER SELECTION switches in AMPS position, and adjust (M) unit CURRENT LIMITER control for desired meter reading. The regulated current will be the sum of (M) and (S) unit meter readings.
 - (c) Place power ON-OFF switches in OFF position and remove jumper across load.

8. Place power ON-OFF switches in ON Position and check that digital panel meter illuminates.
9. Check that digital panel meter* indicates desired values; adjust OUTPUT VOLTAGE control knobs and CURRENT LIMITER control as required to obtain correct indications.

*Ammeter indicates a nominal 1 to 2 milliamperes offset from zero, which is the sensing divider current and not load current. For load current use the 1 to 2 ma. point as zero point.

10. Power supplies are now in proper operation.

OPERATION AFTER PROTECTIVE DEVICE SHUTDOWN

Thermostat Shutdown. The thermostat opens the input circuit only when the temperature of the transistor heat radiator exceeds a maximum safe value. The thermostat will automatically reset when the temperature of the radiator decreases to safe operating value. After eliminating the cause(s) for overheating and allowing time for the power supply to cool to a proper temperature, resume operation of the supply. Refer to appropriate operation paragraph in DETAILED OPERATING PROCEDURES.

Fuse Shutdown. Internal component failure is prevented by fuses which protect the components from damage caused by excessive currents. Fuses will blow when the maximum rated current value for the fuse is exceeded. Fatigue failure of fuses can occur when mechanical vibrations from the installation combine with thermally induced stresses to weaken the fuse metal. Many fuse failures are caused by a temporary condition, and replacing the blown fuse will make the fuse protected circuit operative.

MAINTENANCE

GENERAL

This section describes trouble analysis routine, replacement procedures, calibration and test procedures that are useful for servicing the Lambda power supply. Refer to the section on SPECIFICATIONS AND FEATURES for the minimum performance standards.

TROUBLE ANALYSIS

Whenever trouble occurs, systematically check all fuses, primary power lines, external circuit elements, and external wiring for malfunction before troubleshooting the equipment. Failures and malfunctions often can be traced to simple causes such as improper jumper and supply-load connections or fuse failure due to metal fatigue.

Use the electrical schematic diagram and block diagram, figure 11, as an aid to locating trouble causes. The schematic diagram contains various circuit voltages that are averages for normal operation. Measure these voltages using the conditions for measurement specified on the schematic diagram. Use measuring probes carefully to avoid causing short circuits and damaging circuit components.

CHECKING TRANSISTORS AND CAPACITORS

Check transistors with an instrument that has a highly limited current capability. Observe proper polarity for PNP or NPN to avoid error in measurement. The forward transistor resistance is low but never zero; backward resistance is always higher than the forward resistance.

For good transistors, the forward resistance for any junction is always greater than zero.

Do not assume trouble is eliminated when only one part is replaced. This is especially true when one transistor fails, causing other transistors to fail. Replacing only one transistor and turning power on, before checking for additional defective components could damage the replaced component.

When soldering semi-conductor devices, wherever possible, hold the lead being soldered with a pair of pliers placed between the component and the solder joint to provide an effective heat sink.

NOTE: The leakage resistance obtained from a simple resistance check of a capacitor is not always an indication of a faulty capacitor. In all cases the capacitors are shunted with resistances, some of which have low values. Only a dead short is a true indication of a shorted capacitor.

PRINTED CIRCUIT BOARD MAINTENANCE TECHNIQUES

1. If foil is intact but not covered with solder, it is a good contact. Do not attempt to cover with solder.
2. Voltage measurements can be made from either side of the board. Use a needle-point probe to penetrate to the wiring whenever a protective coating is used on the wiring. A brass probe can be soldered to an alligator clip adapted to the measuring instrument.
3. Wherever possible, use a heat sink when soldering transistors.
4. Broken or damaged printed wiring is usually the result of an imperfection, strain, or careless soldering. To repair small breaks, tin a short piece of hook-up wire to bridge the break, and holding the wire in place, flow solder along the length of wire so that it becomes part of the circuitry.
5. When unsoldering components from the board, never pry or force loose the part; unsolder the component by using the wicking process described below:
 - (a) Select a 3/16 inch tinned copper braid for use as a wick; if braid is not available, select AWG No. 14 or No. 16 stranded wire with 1/2 inch insulation removed.
 - (b) Dip the wick in liquid rosin flux.
 - (c) Place the wick onto the soldered connection and apply soldering iron onto the wick.
 - (d) When sufficient amount of solder flows onto the wick, freeing the component, simultaneously remove iron and wick.

COMPLETE POWER SUPPLY CALIBRATION PROCEDURE

When the power supply is to be completely calibrated, the controls listed below must be calibrated in the order listed.

Control Calibration Order

R102 V_0 max adjust
R111 I_0 at V_0 min adjust
R104 I_0 at V_0 max adjust
R304 meter reference calibration
R313 Voltmeter calibration
R342 Ammeter calibration

ADJUSTMENT OF VOLTAGE CALIBRATION CONTROL R102

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature or 25-30°C and is operated at nominal line voltage, no load.

Whenever R101, R1 or IC101 are replaced, and voltage indications do not reflect maximum ratings, adjust R102 as follows:

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R102 from resistor housing.
3. Place power ON-OFF switch in ON position.
4. Turn OUTPUT VOLTAGE controls (R1) fully CW.
5. Connect a DVM, John Fluke model 825A or equivalent, to supply output terminals and measure output voltage. Adjust R102 until maximum output voltage, as indicated by the DVM, is reached.
6. Place power ON-OFF switch in OFF position.
7. After adjustment is completed, remove AC power input to the supply and reseal the wiper of R102 to potentiometer housing.

ADJUSTMENT OF CURRENT CALIBRATION CONTROL R111

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature of 25-30°C and is operated at nominal line voltage.

Whenever R111, R110, R2, IC101, IC102, or CR116 are replaced and current indications do not reflect published ratings at V_{0min} , adjust R111 as follows:

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R111 from resistor housing. Turn R111 fully clockwise.
3. Place an external ammeter between +V and -V terminals.
4. Turn CURRENT LIMITER control (R2) fully CW.
5. Place power ON-OFF switch in ON position.
6. Slowly adjust R111 counterclockwise until output current (as read on external ammeter) is 105% of V_o min rating for the supply. Refer to table II for maximum current ratings. DO NOT TURN R111 BEYOND THIS POINT.
7. Place power ON-OFF switch in OFF position.
8. After adjustment is completed, remove AC power input to the supply and reseal the wiper of R111 to potentiometer housing.

ADJUSTMENT OF CURRENT CALIBRATION CONTROL R104

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature of 25-30°C and is operated at nominal line voltage.

Whenever R2, R3, R103, R104 and IC101 are replaced, and current indications do not reflect published ratings at V_o max, adjust R104 as follows:

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R104 from resistor housing. Set R104 fully CCW.
3. Connect an ammeter in series with the load.

4. Turn CURRENT LIMITER control (R2) fully CW.
5. Place power ON-OFF switch in ON position.
6. Slowly adjust R104 CW to obtain 105% of maximum rated output current, as indicated by external ammeter. DO NOT TURN BEYOND THIS POINT.
7. Place power ON-OFF switch in OFF position.
8. After adjustment is completed, remove AC power input to the supply and reseal the wiper of R104 to potentiometer housing.

ADJUSTMENT OF METER REFERENCE CALIBRATION CONTROL, R304

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature of 25-30°C and is operated at nominal line voltage, with no load.

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R304 from resistor housing.
3. Connect a digital voltmeter, Data Technology Model 4D or equivalent, plus lead to terminal TP2 and minus lead to terminal TP1.
4. Place power ON-OFF switch in ON position. Adjust R304 until digital voltmeter indicates 100 millivolts.
5. Place power ON-OFF switch in OFF position.
6. After adjustment is completed, remove AC power input to the supply and reseal the wiper of R304 to the potentiometer housing.

ADJUSTMENT OF VOLTMETER CALIBRATION CONTROL, R313.

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature of 25-30°C and is operated at nominal line voltage, no load.

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R313 from resistor housing.
3. Connect a DVM (John Fluke Model 825A or equivalent) at rear output sensing terminals +S and -S to measure output voltage.
4. Place power ON-OFF switch in ON position.
5. Observing the DVM, adjust front panel voltage control for rated maximum output voltage.
6. Place METER SELECTION switch in VOLTS position.
7. Adjust R313 so that front panel meter reading is identical to external DVM reading.
8. Place power ON-OFF switch in OFF position.
9. After adjustment is completed, remove AC power to the supply and reseal the wiper of R313 to the potentiometer housing.

ADJUSTMENT OF AMMETER CALIBRATION CONTROL, R342

The adjustment procedure requires that the power supply is removed from associated equipment, is at an ambient temperature of 25-30°C and is operated at nominal line voltage.

1. Apply AC power to the supply and place power ON-OFF switch in OFF position.
2. Break seal on wiper of R342.
3. Connect an external ammeter between the +V and -V output terminals.
4. Place power ON-OFF switch in the ON position.
5. Observing the external ammeter, adjust the front panel CURRENT LIMITER control for maximum rated current.
6. Place METER SELECTION switch in AMPS position.
7. Adjust R342 so that front panel meter reading is identical to reading indicated by the external ammeter.
8. Place power ON-OFF switch in OFF position.
9. After adjustment is completed, remove AC power to the supply and reseal the wiper of R342 to the potentiometer housing.

PERFORMANCE CHECKS

Checks With Constant Voltage Operation. Check the ripple and regulation of the power supply using the test connection diagram shown in figure 12. Use suggested test equipment or equivalent to obtain accurate results. Refer to SPECIFICATIONS AND FEATURES for minimum performance standards.

Set the differential meter, DC DVM (John Fluke Model 871A or equivalent) to the selected power supply operating voltage. Check the power supply load regulation accuracy while switching from the load to no load condition. Long load leads should be a twisted pair to minimize AC pick-up.

Use a Variac to vary the line voltage from 105-132 or 132-105 volts AC and check the power-supply line regulation accuracy on the differential meter.

Use a VTVM, Ballantine 320 or equivalent, to measure rms ripple voltage of the power supply DC output. Use oscilloscope to measure peak-to-peak ripple voltage of the power supply DC output.

Checks With Constant Current Operation. Check the ripple or regulation of the power supply using the test connection diagram shown in figure 13. Refer to SPECIFICATIONS AND FEATURES for minimum performance standards.

Check the power supply load regulation accuracy while switching from the short circuit to load condition. Measure the voltage across sensing resistor R_s . Use John Fluke Model 871A or equivalent for the DVM connected across R_s . For R_s , use a resistor having the same value as resistor R3 in the unit being tested. To obtain regulation figure substitute values obtained into regulation formula:

$$\frac{\Delta E}{R_s} = \text{Regulation in milliamperes,}$$

where ΔE is the voltage change in millivolts and R_s is the resistance of the sensing resistor.

Use a Variac to vary the line voltage from 105-132 or 132-105 volts AC and check the power supply line regulation accuracy using the VTVM and the regulation formula:

$$\frac{\Delta E}{R_s}$$

SERVICE

When additional instructions are required or repair service is desired, contact the nearest Lambda office where trained personnel and complete facilities are ready to assist you.

Please include the power supply model and serial number together with complete details of the problem. On receipt of this information Lambda will supply service data or advise shipping for factory repair service.

All repairs not covered by the warranty will be billed at cost and an estimate forwarded for approval before work is started.

PARTS ORDERING

Standard components and special components used in the Lambda power supply can be obtained from the factory. In case of emergency, critical spare parts are available through any Lambda office.

The following information must be included when ordering parts:

1. Model number and serial number of power supply and purchase date.
2. Lambda part number.
3. Description of part together with circuit designation.
4. If part is not an electronic part, or is not listed, provide a description, function and location of the part.

PARTS LIST

The electrical parts located on Lambda models LQ-530 -- LQ-534 are listed here. Parts common to a group of models are listed first. Unique parts of individual models within the group are listed separately, by model, immediately following the group common parts listing.

COMMON PARTS

MODELS LQ-530 -- LQ-534

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
C9	Cap., mica, 330 pf $\pm 5\%$, 600 vdc	CCJ-33-001
C101	Cap., elect., 280 mf -10 +100%, 40 vdc	CBR-28-074
C102	Cap., elect., 100 mf -10 +75%, 40 vdc	CBR-10-108
C103	Cap., mylar, 470 pf $\pm 10\%$, 200 vdc	CGJ-47-002
C104	Cap., mica, 680 pf $\pm 10\%$, 500 vdc	CCJ-68-006
C105	Same as C103	
C107	Cap., elect., 800 mf -10 +100%, 15 vdc	CBR-80-099
C108,	Cap., elect., 40 mf (37 mf min --	CBP-40-014
C109	75 mf max), 35 vdc	
C110	Cap., elect., 10 mf $\pm 20\%$, 10 vdc	CBP-10-027
C114	Cap., mylar, 0.1 mf $\pm 10\%$, 80 vdc	CGM-22-002
C115	Cap., elect., 39 mf $\pm 10\%$, 10 vdc	CBP-39-072
C116	Cap., mylar, 0.33 mf $\pm 10\%$, 100 vdc	CGM-33-012
C117,	Cap., ceramic, 0.01 mf $\pm 20\%$,	CDL-10-004
C118	1,000 vdc	
C301	Cap., mylar, 0.1 mf $\pm 10\%$, 200 vdc	CAM-10-012
C302	Cap., mylar, 0.47 mf $\pm 10\%$, 200 vdc	CGM-47-016
C303	Cap., mylar, 0.22 mf $\pm 10\%$, 200 vdc	CGM-22-002
C304	Cap., mica, 100 pf $\pm 5\%$, 500 vdc	CCJ-10-007
C305	Cap., mylar, 0.01 mf $\pm 10\%$, 200 vdc	CGL-10-002
CR9	Rectifier	FBL-00-103
CR101	Rectifier	FBL-00-030
thru		
CR104		
CR105	Rectifier	FBL-00-092
CR106	Same as CR101	
CR109	Same as CR101	
CR112	Same as CR101	
thru		
CR115		
CR116	Rectifier, zener diode	FBM-Z133
CR124	Rectifier	FBL-00-105
CR132	Same as CR116	
CR133	Same as CR124	
CR305	Rectifier, zener diode	FBM-Z140
CR306,	Rectifier	FBL-00-196
CR307		
CR308,	Same as CR101	
CR309		
F1	Fuse, 7A, 125V, SLO-BLO	FFC-07-000
IC101	Integrated circuit	FBT-00-128
IC102	Integrated circuit	FBT-00-132
IC103	Integrated circuit	FBT-00-047
IC104	Integrated circuit	FBT-00-046
IC301	Integrated circuit	FBT-00-075
thru		
IC303		
IC304	Integrated circuit	FBT-00-074
IC306	Integrated circuit	FBT-00-137
Q302	Transistor	FBN-L199
R2	Res., var., ww, 400 ohms $\pm 5\%$, 2 w	DNR-40-061

COMMON PARTS (Cont.)

MODELS LQ-530 -- LQ-534 (Cont.)

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
R101	Res., film, 7,500 ohms $\pm 1\%$, 1/8 w	DCS-75-145
R102	Res., var., cermet, 5,000 ohms $\pm 10\%$, 3/4 w @ 75°C	DRS-50-034
R103	Res., film, 1,000 ohms $\pm 5\%$, 1/2 w	DCS-10-019
R104	Res., var., cermet, 2,000 ohms $\pm 20\%$, 1 w @ 25°C	DRS-20-012
R106	Res., comp., 100,000 ohms $\pm 10\%$, 1/4 w	DCB-1041
R110	Res., film, 887 ohms $\pm 0.5\%$, 1/4 w	DCR-89-094
R111	Res., var., cermet, 10,000 ohms $\pm 10\%$, 1 w @ 25°C	DRT-10-048
R112	Res., comp., 560 ohms $\pm 10\%$, 1 w	DGB-5611
R118	Res., comp., 330 ohms $\pm 10\%$, 1/2 w	DEB-3311
R126	Res., comp., 220 ohms $\pm 10\%$, 1/4 w	DCB-2211
R302	Res., film, 47,500 ohms $\pm 1\%$, 1/2 w	DCT-47-040
R303	Res., film, 100,000 ohms $\pm 2\%$, 1/2 w	DCV-10-038
R304	Same as R104	
R305	Res., comp., 1.2 megohms $\pm 10\%$, 1/2 w	DEB-1251
R312	Res., film, 953,000 ohms $\pm 1\%$, 1/2 w	DCV-95-042
R313	Res., var., cermet, 100,000 ohms $\pm 10\%$, 1 w	DRV-10-019
R316	Res., comp., 270 ohms $\pm 10\%$, 1/2 w	DEB-2711
R320	Same as R316	
R321	Res., comp., 820 ohms $\pm 10\%$, 1/2 w	DEB-8211
R322,	Same as R316	
R323		
R325	Res., comp., 1,000 ohms $\pm 10\%$, 1/2 w	DEB-1021
R326	Res., comp., 330,000 ohms $\pm 10\%$, 1/2 w	DEB-3341
R327	Res., comp., 51,000 ohms $\pm 5\%$, 1/2 w	DEB-5135
R328	Res., comp., 68,000 ohms $\pm 10\%$, 1/2 w	DEB-6831
R329	Same as R325	
R330	Res., film, 2,000 ohms $\pm 2\%$, 1/4 w	DCS-20-067
R331	Res., film, 24,300 ohms $\pm 1\%$, 1/4 w	DCT-24-105
R341	Res., film, 1,000 ohms $\pm 1\%$, 1/2 w	DCS-10-036
S1	Switch, toggle, ON-OFF	FDA-11-040
S2	Thermostat	FKA-142-015
S301	Switch, slide, METER SELECTOR	FDE-22-002

UNIQUE PARTS

MODEL LQ-530

C1	Cap., elect., 32,000 mf -10 +100%, 30 vdc	CBT-32-122
C2	Cap., elect., 1,500 mf -10 +100%, 30 vdc	CBS-15-217
C3,	Cap., mylar, 0.22 mf $\pm 10\%$,	CGM-47-016
C4	200 vdc	
C5	Cap., elect., 12 mf -10+100%, 100 vdc	CBP-12-041
C6	Cap., elect., 3.9 mf $\pm 10\%$, 50 vdc	CBN-39-041
CR1,	Rectifier	
CR2		

UNIQUE PARTS (Cont.)
MODEL LQ-530 (Cont.)

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
CR5	Same as CR1	
CR110, CR111	Rectifier	FBL-00-030
F2	Fuse 30A, 32V, NORM-BLO	FFB-30-000
Q1	Transistor, NPN	FBN-36220
thru Q6		
Q7	Transistor, NPN	FBN-35469
Q101	Transistor, NPN	FBN-L109
R1	Res., var., ww, 10,000 ohms (9K+1K) -0 +10%, 2 w ea	DNT-10-076
R3	Res., ww, 0.045 ohm ±5%, 15 w	DFL-45-018
R4	Res., ww, 0.43 ohm ±5%, 7 w	DFM-43-106
thru R9		
R10	Res., ww, 135 ohms ±5%, 15 w	DFR-14-148
R11	Res., film, 82 ohms ±5%, ½ w	DCP-82-020
R107	Res., comp., 120 ohms ±10%, ½ w	DEB-1211
R108	Res., film, 1,050 ohms ±0.5%, ¼ w	DCS-10-088
R109	Res., film, 40,200 ohms ±1%, ½ w	DCT-40-058
R115	Res., comp., 1,800 ohms ±10%, ½ w	DEB-1821
R311	Res., film, 1,000 ohms ±1%, ½ w	DCS-10-036
R340	Same as R109	
R342	Res., var., cermet, 10,000 ohms ±10%, 1 w @ 25°C	DRT-10-048
T1	Transformer	ABA-LQ530-1

MODEL LQ-531

C1	Cap., elect., 16,000 mf -10 +100%, 50 vdc	CBT-16-121
C2	Cap., elect., 860 mf -10 +75%, 50 vdc	CBR-86-200
C3, C4	Cap., mylar, 0.22 mf ±10%, 200 vdc	CGM-47-016
C5	Cap., elect., 12 mf -10 +100%, 100 vdc	CBP-12-041
CR1, CR2	Rectifier	FBL-00-054
CR5	Same as CR1	
CR110, CR111	Rectifier	FBL-00-030
F2	Fuse 20A, 3.2V, NORM-BLO	FFB-20-000
Q1	Transistor	
Q7	Transistor, NPN	FBN-35469
Q101	Transistor, NPN	FBN-L109
R1	Res., var., ww, 20,000 ohms (19K+1K) ±10%, 2 w ea	DNT-20-043
R3	Res., ww, 0.070 ohm ±5%, 15 w	DFL-70-019
R4	Res., ww, 0.74 ohm ±5%, 5 w	DFM-74-107
thru R9		
R10	Res., ww, 135 ohms ±5%, 15 w	DFR-14-148
R11	Res., film, 182 ±1%, ½ w	DCR-18-108
R107	Res., comp., 120 ohms ±10%, ½ w	DEB-1211
R108	Res., film, 562 ohms ±1%, ¼ w	DCR-56-099
R109	Res., film, 40,200 ohms ±1%, ½ w	DCT-40-058
R115	Res., comp., 4,300 ohms ±5%, ½ w	DEB-4325
R311	Res., film, 1,000 ohms ±1%, ½ w	DCS-10-036

UNIQUE PARTS (Cont.)
MODEL LQ-531 (Cont.)

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
R342	Res., var., cermet, 10,000 ohms ±10%, 1 w @ 25°C	DRT-10-048
T1	Transformer	ABA-LQ531-1

MODEL LQ-532

C1	Cap., elect., 9,700 mf -10 +100%, 75 vdc	CBS-97-214
C2	Cap., elect., 500 mf -10 +75%, 75 vdc	CBR-50-198
C3	Cap., mylar, 0.22 mf ±10%, 200 vdc	CGM-47-016
C5	Cap., elect., 5.6 mf -10 +50%, 250 vdc	CBN-56-026
CR1	Rectifier	FBL-00-064
thru CR7		
CR110, CR111	Rectifier	FBL-00-030
F2	Fuse, 10A, 125V, NORM-BLO	FFK-10-000
Q1	Transistor, NPN	FBN-36487
thru Q6		
Q7	Transistor, NPN	FBN-36488
Q101	Transistor, NPN	FBN-L108
R1	Res., var., ww, 40,000 ohms -0 +40%, 2 w	DNT-40-074
R3	Res., ww, 0.120 ohm ±5%, 10 w	DFM-12-104
R4	Res., ww, 1.36 ohm ±3%, 3 w	DFN-14-066
thru R9		
R10	Res., ww, 300 ohms ±5%, 15 w	DFR-30-132
R11	Res., film, 390 ±2%, ½ w	DCR-39-046
R107	Res., comp., 120 ohms ±10%, ½ w	DEB-1211
R108	Res., film, 82 ohms ±5%, ¼ w	DCP-82-020
R109	Res., film, 40,200 ohms ±1%, ½ w	DCT-47-040
R115	Res., comp., 13,000 ohms ±5%, ½ w	DEB-1335
R311	Res., film, 1,000 ohms ±1%, ½ w	DCS-10-036
R342	Res., var., cermet, 20,000 ohms ±10%, 1 w @ 25°C	DRT-20-051
T1	Transformer	ABA-LQ532-1

MODEL LQ-533

C1	Cap., elect., 4,800 mf -10 +75%, 110 vdc	CBS-48-219
C2	Cap., elect., 320 mf -10 +75%, 110 vdc	CBR-32-197
C3	Cap., mylar, 0.068 mf ±10%, 400 vdc	CGL-68-004
C5	Cap., elect., 5.6 mf -10 +50%, 250 vdc	CBN-56-026
CR1	Rectifier	FBL-00-054
thru CR8		
CR110, CR111	Rectifier	FBL-00-030
F2	Fuse, 7A, 125V, NORM-BLO	FFC-07-000
Q1	Transistor, NPN	FBN-36220
thru Q6		

UNIQUE PARTS (Cont.)
MODEL LQ-533 (Cont.)

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
Q7	Transistor, NPN	FBN-35903
Q101	Transistor, NPN	FBN-L108
R1	Res., var., ww, 60,000 ohms -0 +10%, 2 w	DNT-60-075
R3	Res., ww, 0.160 ohm $\pm 5\%$, 5 w	DFM-16-105
R4	Res., ww, 2.0 ohms $\pm 3\%$, 3 w	DFN-20-009
thru R9		
R10	Res., ww, 750 ohms $\pm 5\%$, 15 w	DFR-75-149
R11	Res., film, 562 ohms $\pm 1\%$, $\frac{1}{4}$ w	DCR-56-099
R107	Res., comp., 120 ohms $\pm 10\%$, $\frac{1}{2}$ w	DEB-1211
R108	Res., film, 332 ohms $\pm 1\%$, $\frac{1}{4}$ w	DCR-10-016
R109	Res., film, 95,300 ohms $\pm 1\%$, $\frac{1}{2}$ w	DCT-95-027
R115	Res., comp., 27,000 ohms $\pm 10\%$, $\frac{1}{2}$ w	DEB-2731
R311	Res., film, 1,000 ohms $\pm 1\%$, $\frac{1}{2}$ w	DCS-10-036
R342	Res., var., cermet, 20,000 ohms $\pm 10\%$, 1 w @ 25° C	DRT-20-051
T1	Transformer	ABA-LQ533-1
<u>MODEL LQ-534</u>		
C1	Cap., elect., 2,600 mf -10 + 75%, 200 vdc	CBS-26-218
C2	Cap., elect., 170 mf -10 +75%, 200 vdc	CBR-17-196
C3	Cap., mylar, 0.068 mf $\pm 10\%$, 400 vdc	CGL-68-004
C5	Cap., elect., 3.3 mf -10 +50%, 250 vdc	CBN-33-027
C10	Cap., mylar, 0.001 mf $\pm 10\%$, 400 vdc	CGK-10-009
C106	Cap., elect., 680 mf - 10 + 100%, 6.3 vdc	CBR-68-199
C111, C112	Cap., mylar, 0.01 mf $\pm 10\%$, 200 vdc	CGL-10-002
CR1	Rectifier	FBL-00-039
thru CR5		
CR101	Rectifier	FBL-00-030
thru CR104		
CR110, CR111	Rectifier	FBL-00-064
CR117	Same as CR101	
thru CR119		

UNIQUE PARTS (Cont.)
MODEL LQ-534 (Cont.)

<u>CIRC. DESIG.</u>	<u>DESCRIPTION</u>	<u>LAMBDA NO.</u>
F2	Fuse, 4A, 250V, NORM-BLO	FFB-04-000
Q1	Transistor, NPN	FBN-35902
thru Q6		
Q7, Q8	Transistor, NPN	FBN-35903
Q101, Q102	Transistor NPN	FBN-L115
Q103	Transistor, NPN	FBN-L108
R1	Res., var., ww, 120,000 ohms -0 +10%, 2 w	DNV-12-002
R3	Res., ww, 0.30 ohm $\pm 5\%$, 3 w	DFM-30-053
R4	Res., ww, 2.7 ohms $\pm 2\%$, 3 w	DFN-27-053
thru R9		
R11	Res., film, 1,180 ohms $\pm 1\%$, $\frac{1}{2}$ w	DCS-12-133
R107	Res., comp., 390 ohms $\pm 10\%$, $\frac{1}{2}$ w	DEB-391
R108	Res., film, 332 ohms $\pm 1\%$, $\frac{1}{4}$ w	DCR-33-042
R109	Res., film, 174,000 ohms $\pm 1\%$, $\frac{1}{4}$ w	DCV-17-031
R113, R114	Res., film, 31,000 ohms $\pm 1\%$, $\frac{1}{4}$ w	DCT-31-070
R116	Res., ww, 15,000 ohms $\pm 5\%$, 5 w	DFT-15-033
R119	Res., comp., 180 ohms $\pm 10\%$, $\frac{1}{2}$ w	DEB-1811
R120	Res., comp., 150 ohms $\pm 10\%$, $\frac{1}{2}$ w	DEB-1511
R311	Res., film, 100 ohms $\pm 1\%$, $\frac{1}{2}$ w	DCR-10-016
R340	Res., film, 22,600 ohms $\pm 1\%$, $\frac{1}{2}$ w	DCT-23-098
R342	Res., var., cermet, 10,000 ohms $\pm 10\%$, 1 w @ 25° C	DRT-10-048
T1	Transformer	ABA-LQ534-1

"V" AND "V1" OPTION

On LQ-530 — LQ-534 units with "V" or "V1" option;
S1 becomes FDA-21-070; F1 becomes FFC-03-000 and
F3, FFC-03-000, is added.

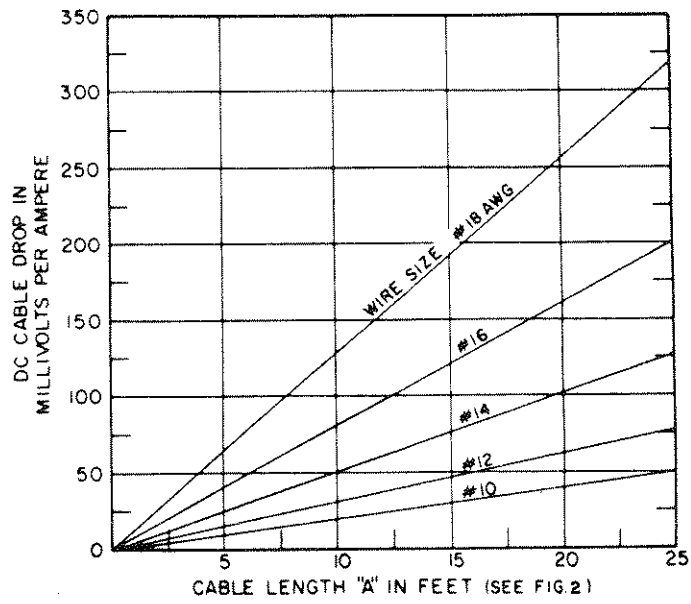


Figure 1. 2-Wire Connection (See Figure 3)



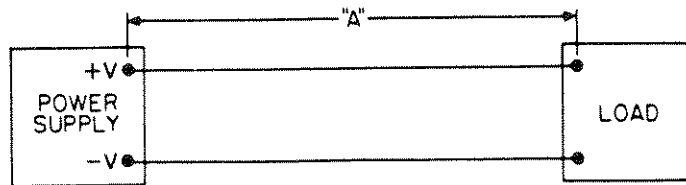


Figure 2. Cable Length "A" in Feet

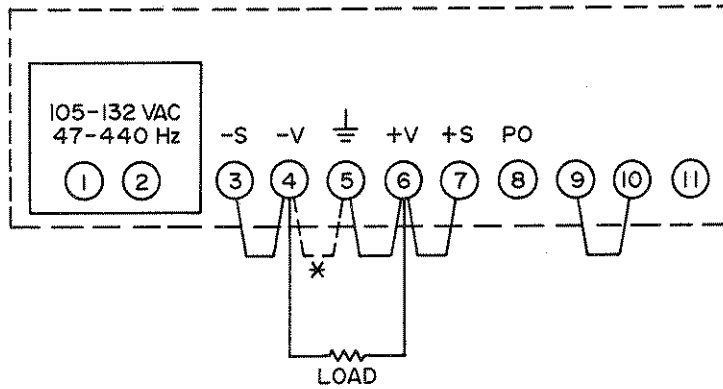


NOTE:
 * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS 4 AND 5.

Figure 3. Two-Wire Connection

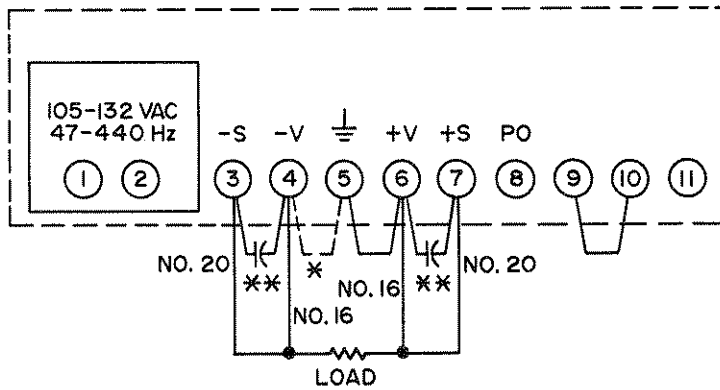


NOTE:
 * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS 4 AND 5.
 ** 2MF, 35V, ELECT. MAY BE REQUIRED TO ELIMINATE NOISE PICK-UP.

Figure 4. Four-Wire Connection

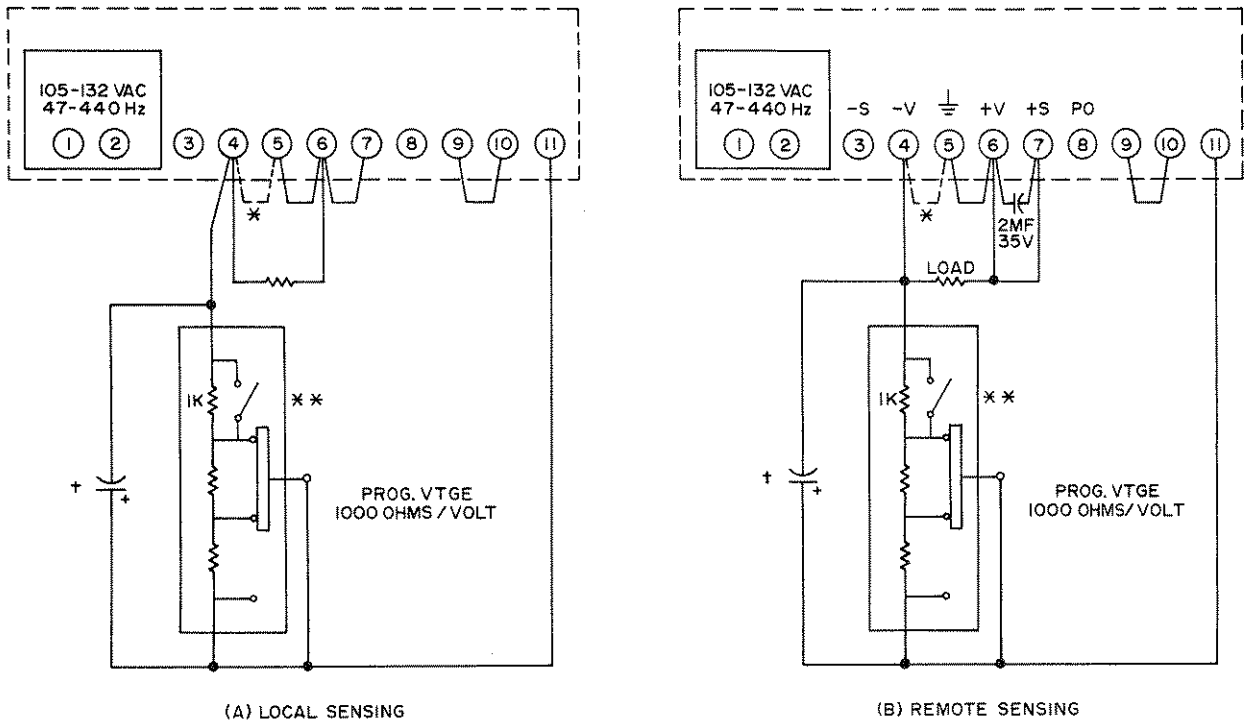


- NOTES:
- * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS 4 AND 5.
 - ** 1K RESISTOR AND SWITCH REPRESENT A TYPICAL METHOD OF ACHIEVING THE PROGRAMMING SEQUENCE DESCRIBED ON PAGE 6.
 - † CAPACITOR TO BE IDENTICAL RATING AS C5 ON SCHEMATIC.

Figure 5. Programmed Voltage, with External Resist

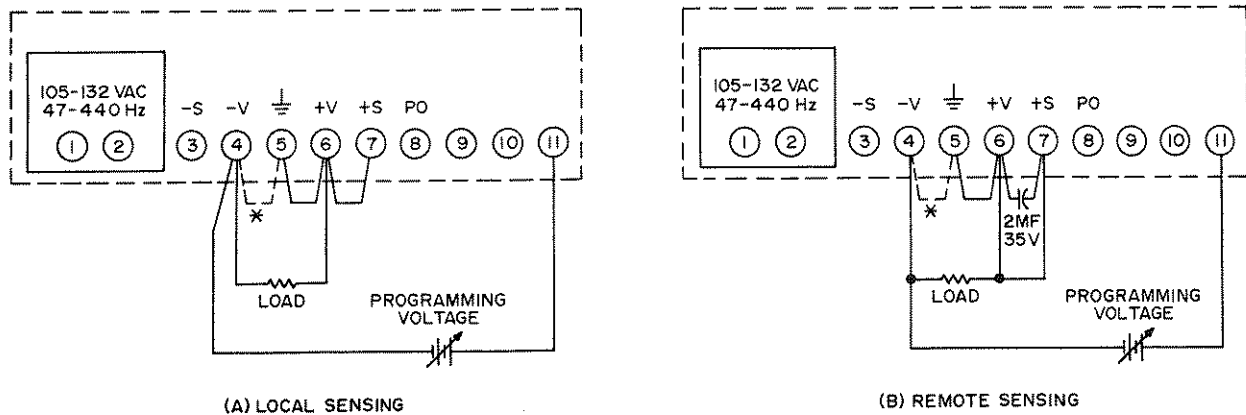


- NOTE:
- * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS 4 AND 5.

Figure 6. Programmed Voltage, with External Programming Voltage Source

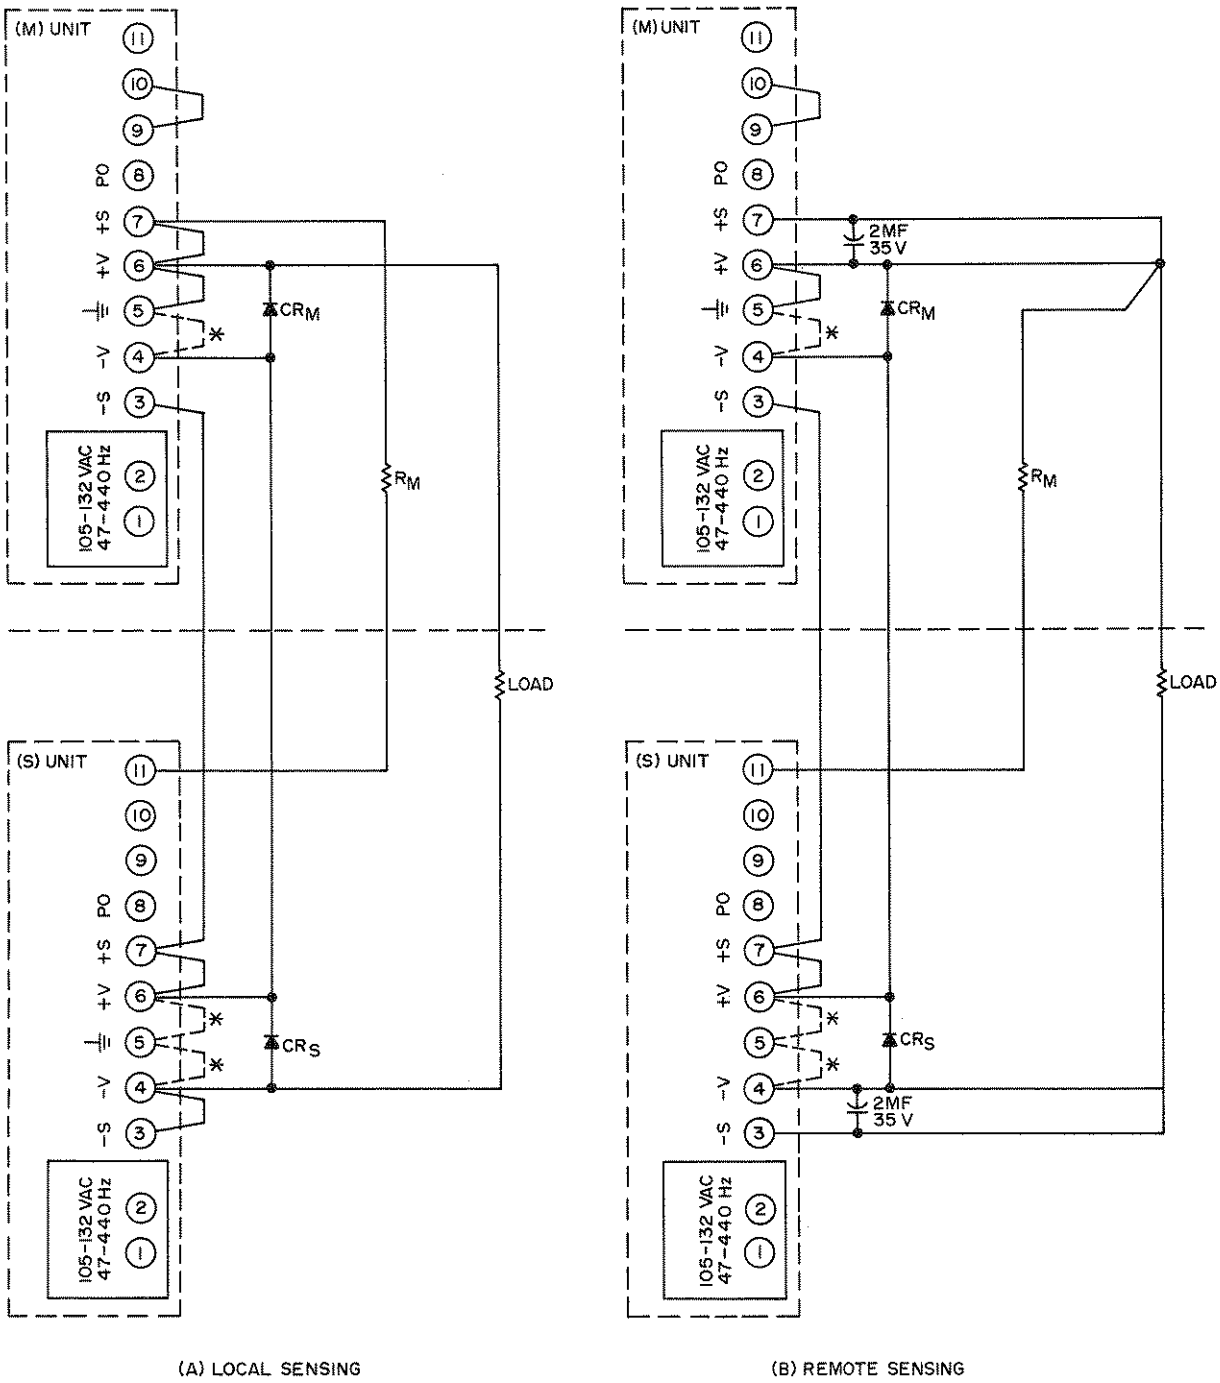

NOTE:
 * MAKE ONLY ONE GROUND CONNECTION FOR THE SERIES COMBINATION TO CHANGE GROUND AS SHOWN, REMOVE JUMPER FROM TERMINALS 5 AND 6 ON (M) UNIT AND CONNECT ANY ONE OF THE OTHER JUMPERS AS SHOWN IN DOTTED LINE.

Figure 7. Series Connection

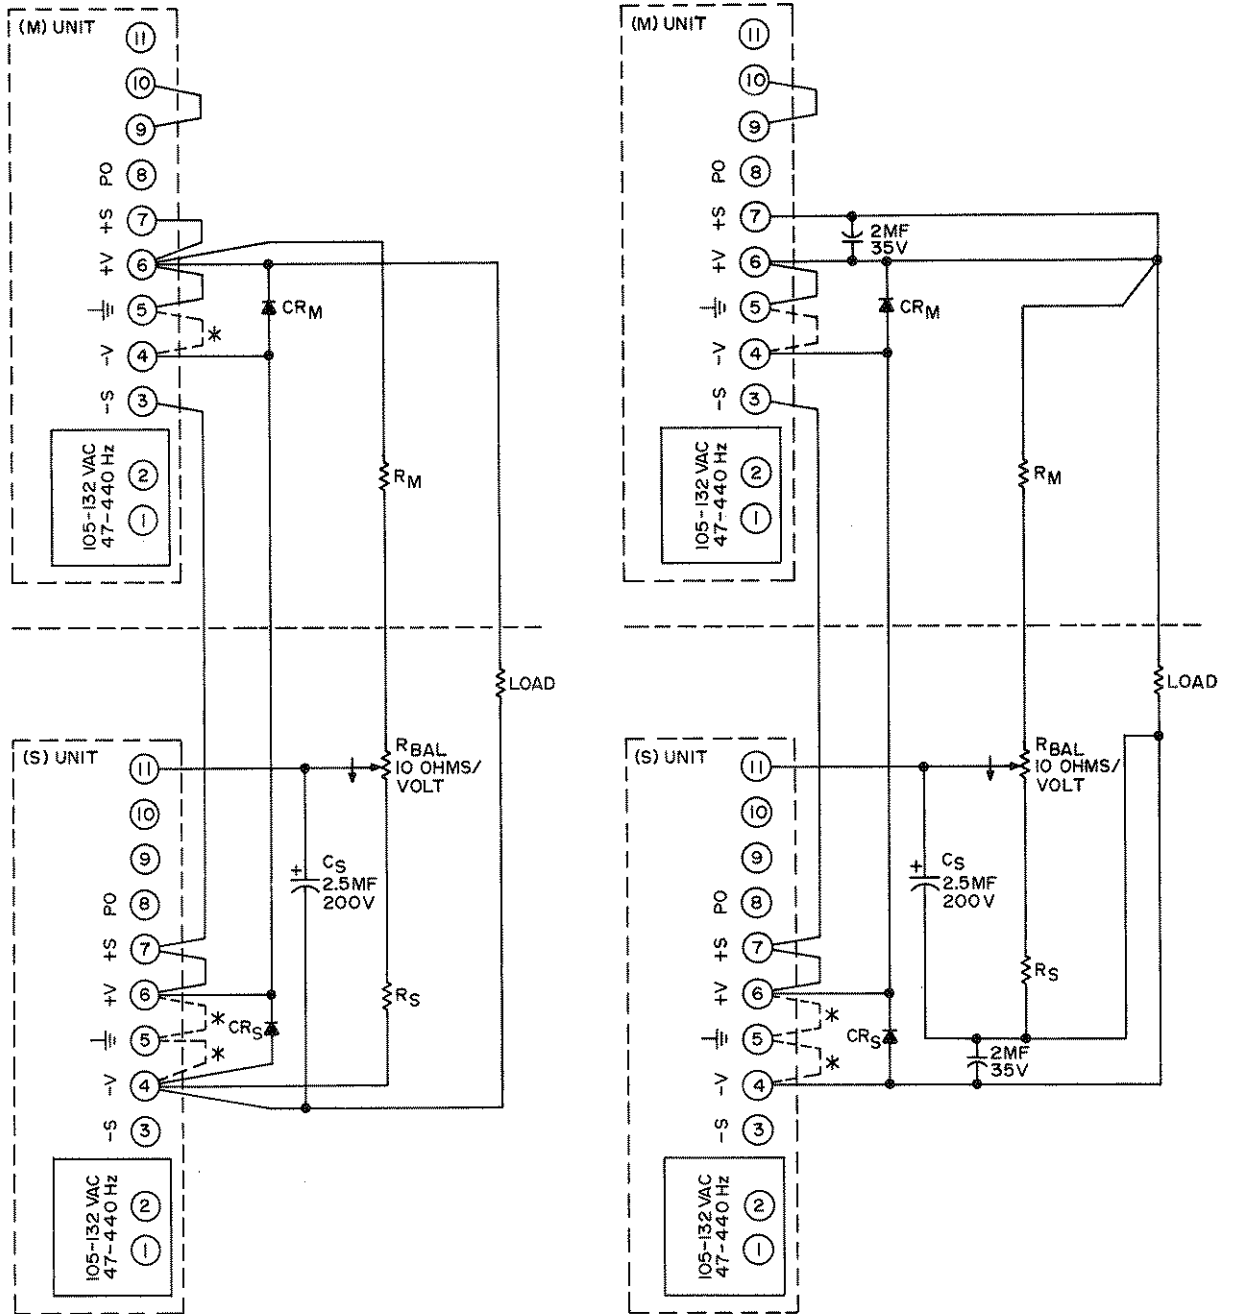


(A) LOCAL SENSING

(B) REMOTE SENSING

NOTE:


* MAKE ONLY ONE GROUND CONNECTION FOR THE SERIES COMBINATION, TO CHANGE GROUND AS SHOWN, REMOVE JUMPER FROM TERMINALS 5 AND 6 ON (M) UNIT AND CONNECT ANY ONE OF THE OTHER JUMPERS AS SHOWN IN DOTTED LINE.

Figure 8. Alternate Series Connection

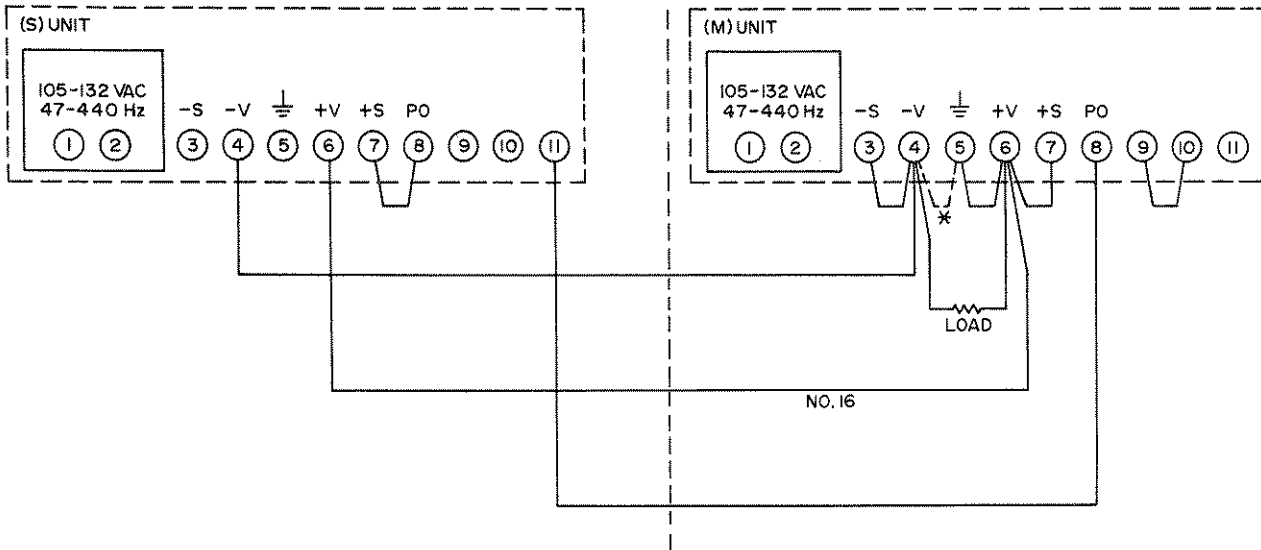


NOTE:
 * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM
 TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS
 4 AND 5.

Figure 9. Parallel Connection, Local Sensing

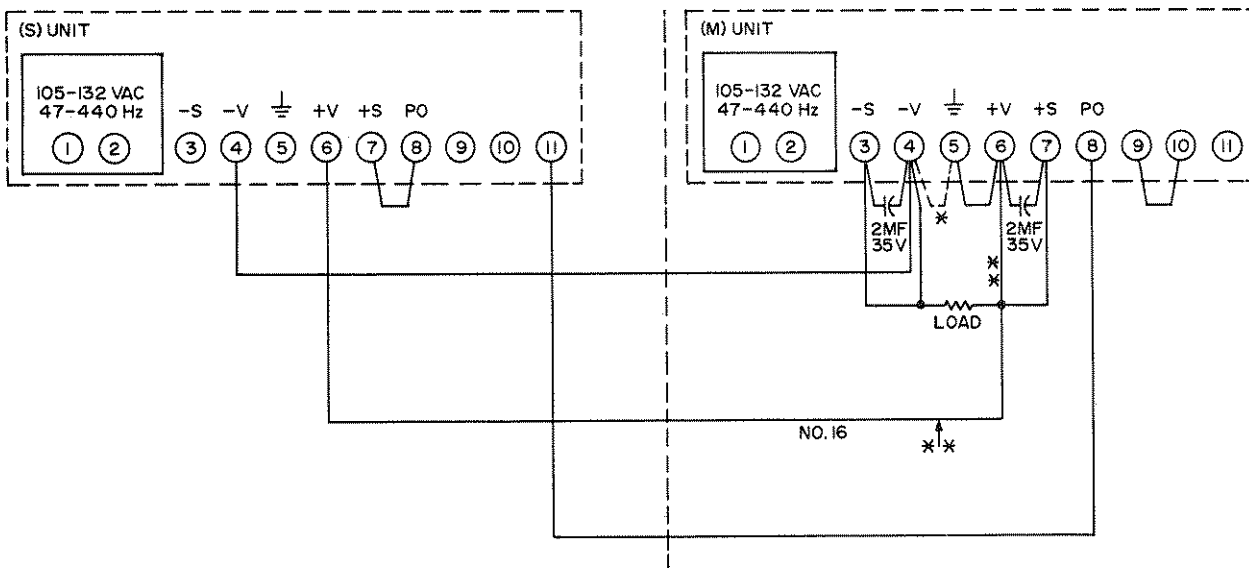


NOTE:
 * FOR NEGATIVE GROUND, DISCONNECT JUMPER FROM
 TERMINALS 5 AND 6 AND RECONNECT TO TERMINALS
 4 AND 5.
 ** LEAD LENGTHS MUST BE EQUAL.

Figure 10. Parallel Connection, Remote Sensing

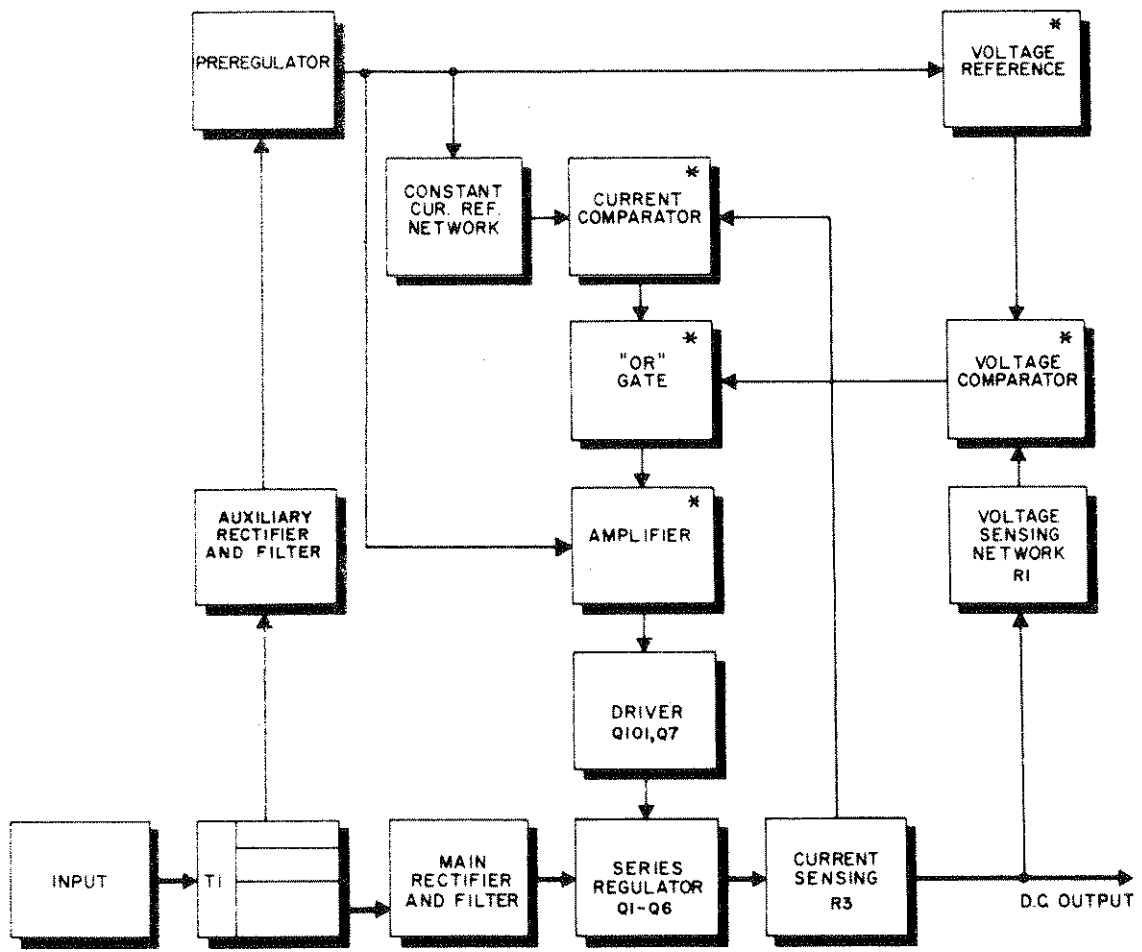


* THIS CIRCUIT ELEMENT IS LOCATED IN IC101.

Figure 11. Typical Block Diagram

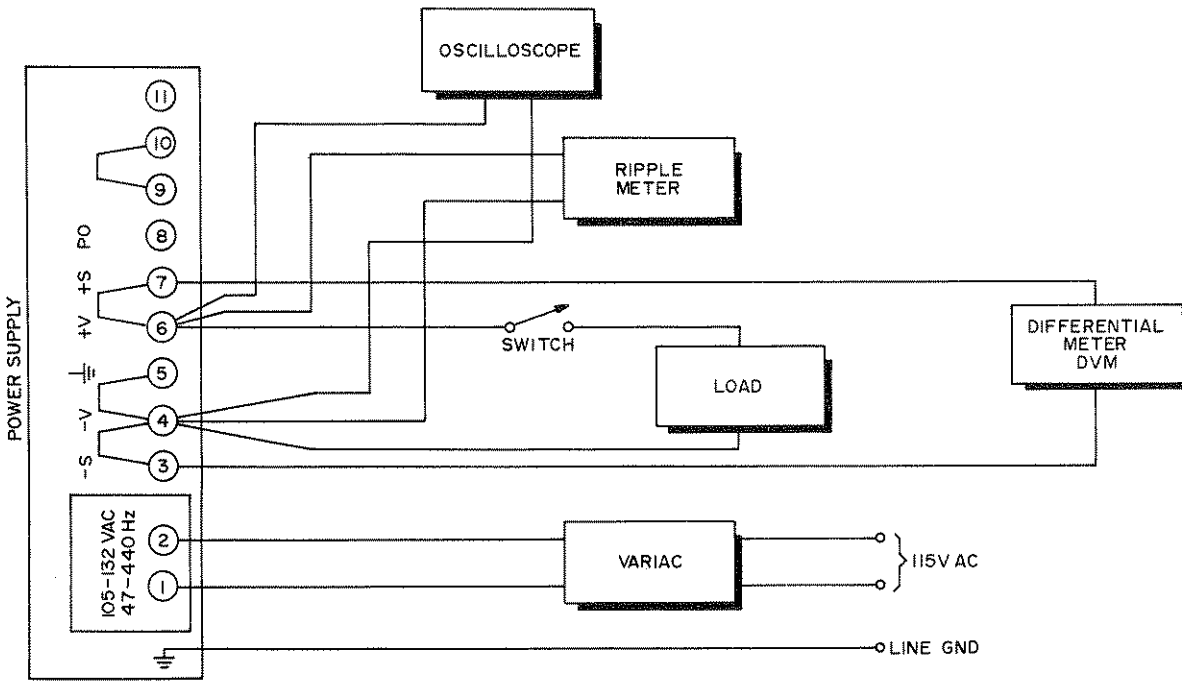


- NOTES:
1. REGULATION AND RIPPLE CHECK METERS MUST NOT BE GROUNDED THROUGH THREE-WIRE LINE CORD TO GROUND.
 2. PERFORM CHECKS WITH LOCAL SENSING CONNECTIONS ONLY.

Figure 12. Test Connections for Constant Voltage Performance Checks

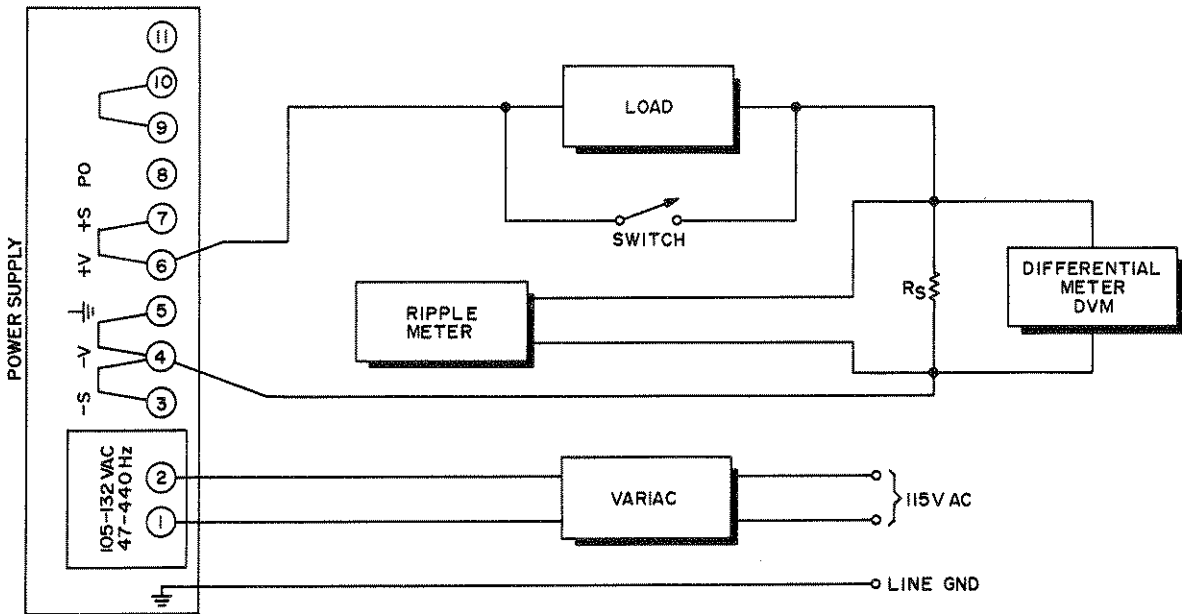

- NOTES:
1. REGULATION AND RIPPLE CHECK METERS MUST NOT BE GROUNDED THROUGH THREE-WIRE LINE CORD TO GROUND.
 2. PERFORM CHECKS WITH LOCAL SENSING CONNECTIONS ONLY.

Figure 13. Test Connections for Constant Current Performance Checks

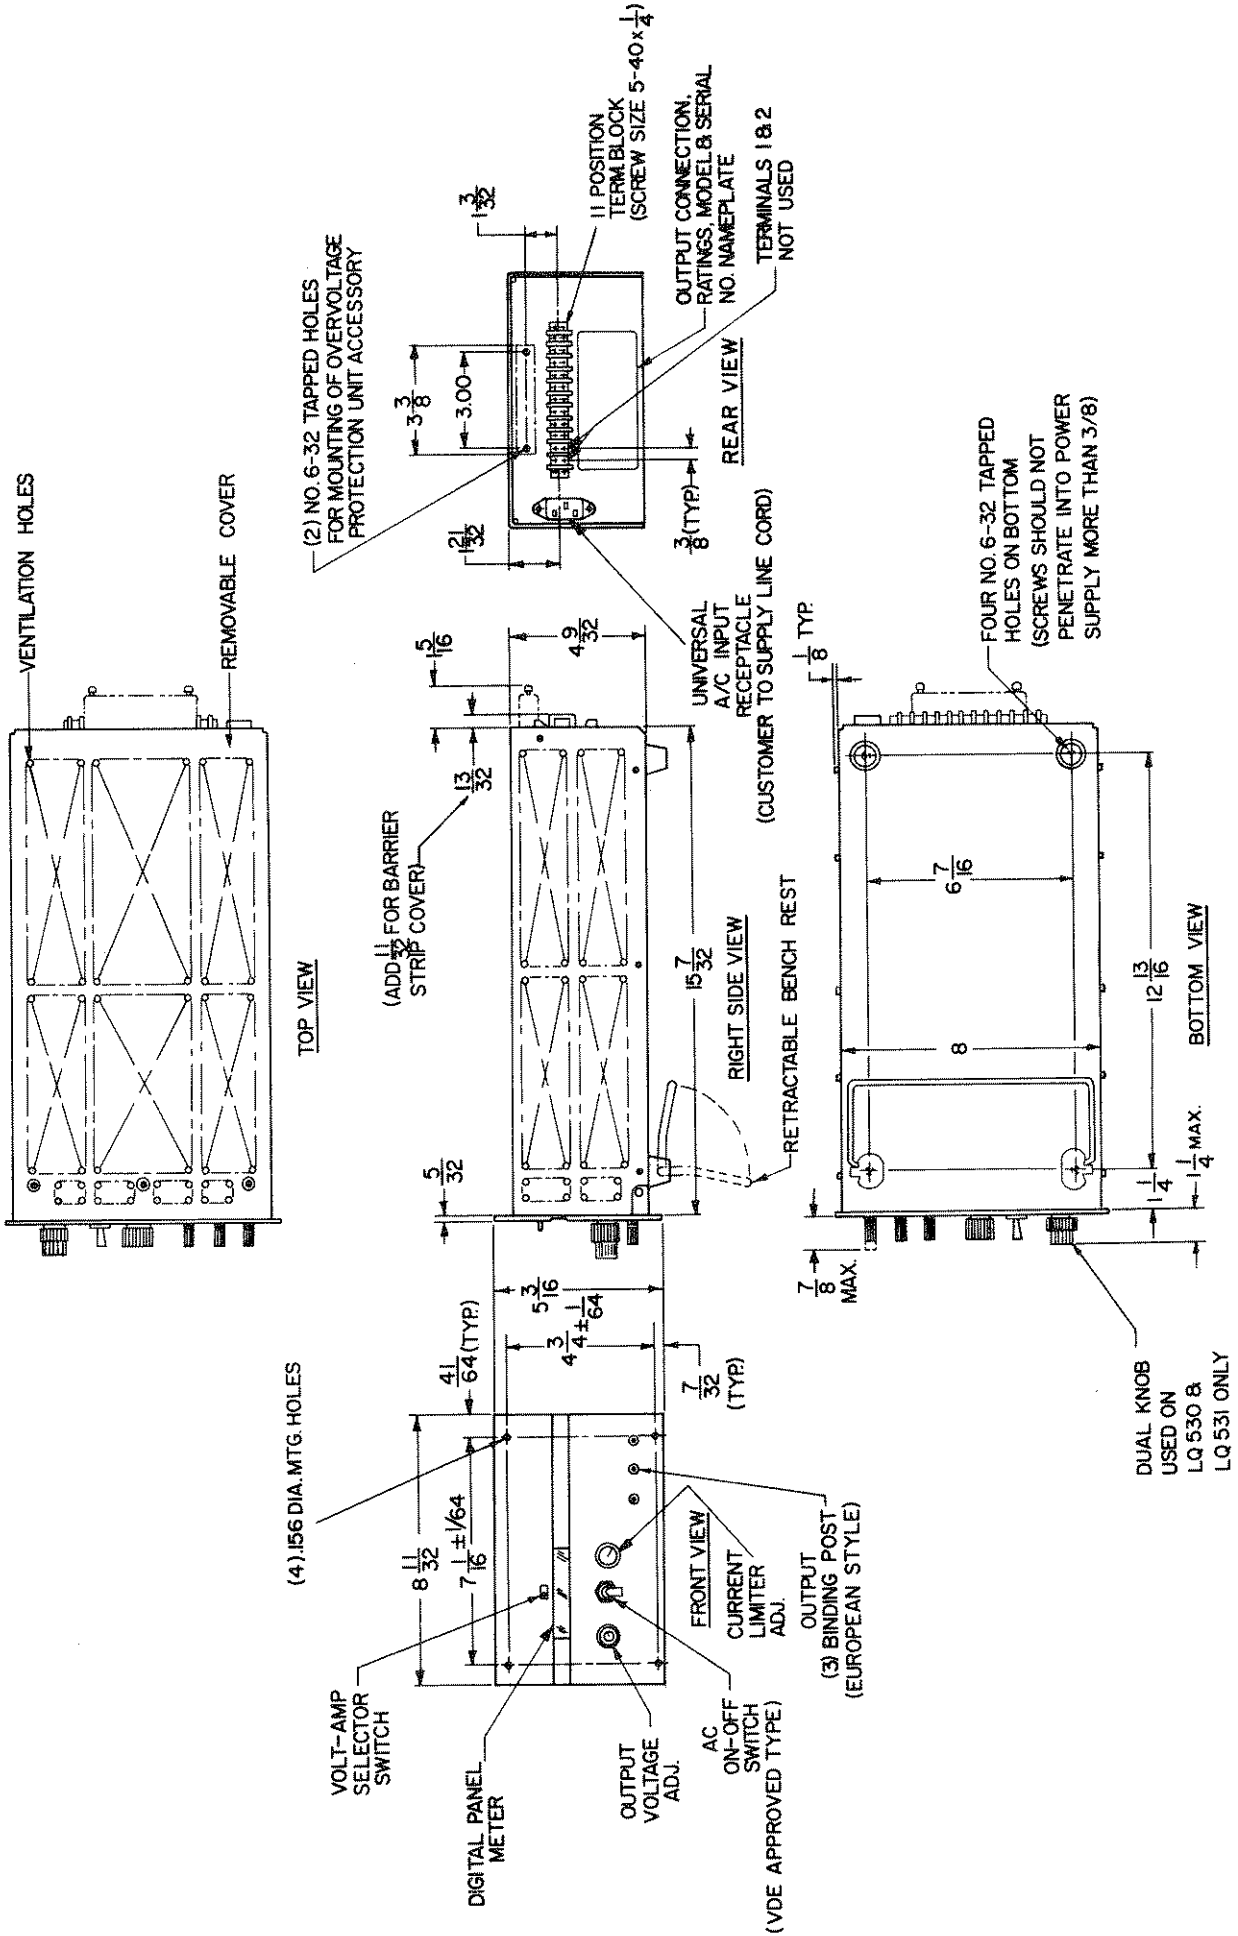

Outline Drawing For V and V1 Option Units

GENERAL DESCRIPTION

Rack adapter LRA-1 is designed for use in equipment racks where ruggedized mounting of units is required. The adapter can be used with or without chassis slides.

Rack adapter LRA-2 is designed for simple applications of rack installation where chassis slides and ruggedized mounting of equipment are not required.

Both rack adapter LRA-1 and LRA-2 can be used to install 1/4-rack or 1/2-rack power supply units into equipment racks. Each adapter can accept various combinations of 1/4 and 1/2-rack units up to four 1/4-rack units or two 1/2-rack units.

INSTALLATION OF 1/2 RACK UNITS INTO LRA-1

To install 1/2-rack power supply units, remove slide numbers 2 and 3 and/or 6 and 7, together with securing hardware and associated slide bar nut.

Using slide screws and slide bar nuts that were removed, store removed slides on the frame at the rear of the adapter where screw clearance holes are provided for securing each slide to the adapter.

SHIPMENT OF UNITS MOUNTED IN LRA-1

To protect the unit against damage from shock and vibrations when transporting adapter with installed units, eight universal tie-down mounting holes, located in the adapter base, at the rear of the rack adapter, are used to secure 1/4-rack and/or 1/2-rack units into the rack adapter. Secure each unit using two 6-32 x 5/8 screws, two lock-washers and two spacers installed from the bottom side of the rack adapter. See detail A for typical securing hardware. Eight spacers are supplied with rack adapter LRA-1.

RUGGEDIZED MOUNTING

When ruggedized mounting of units is required, follow the procedure described for SHIPMENT OF UNITS MOUNTED IN LRA-1. See detail A for typical securing hardware.

MOUNTING CHASSIS SLIDES

Mount chassis slides using the following hardware. To assure unrestricted mounting of units into the adapter designated screw lengths must not be exceeded. Insert screws into designated holes and secure slide in position using long bar nut supplied with rack adapter LRA-1.

CHASSIS TRAK NO. CTS. -116:
10-32 x 7/16 fl-hd (82°);
use A holes.

LAMBDA NO. KHT-34-103 (1 PR)
6-32 x 3/8 pan-hd;
use B, C, and D holes.

GRANT PULLEY NO. 4435:
6-32 x 5/15 fl-hd (100°);
use B and D holes.

USING BLANK PANELS

Blank front panels Model SB-20 and SB-40 are available for covering any 1/4-rack or 1/2-rack opening respectively. The blank panels can be used with rack adapter LRA-1 and LRA-2 whenever a 1/4-rack or 1/2-rack space in the adapter is not occupied by a unit. Secure each panel in position using four 6-32 x 3/8 pan-head screws supplied with the rack adapter.

TABLE I
SCHEMATIC DATA REFERENCES
MODELS LQ530, LQ531, LQ532, LQ533

Model	Schematic Voltage Measurements				Schematic Components						
	A (VAC)	B (VDC)	C (VDC)	D (VDC)	C1	C2	C3	C4	C5	C6	Q1-Q6
LQ530	18.6 (17.6)	+15.4 (+20.0)	-10.58 (-1.48)	-10.0	32,000 mf 30vdc	1,500 mf -10 +100% 30vdc	0.22 mf 80vdc	0.22 mf 200vdc	12.0 mf -10 +100% 50 vdc	3.9 mf 50vdc	36220
LQ531	28.9 (27.5)	+19.2 (+33.0)	-20.6 (-1.1)	-20.0	16,000 mf 50vdc	860 mf 50vdc	0.22 mf 80vdc	0.22 mf 200vdc	12.0 mf -10 +100% 100 vdc	NOT USED	36220
LQ532	49.2 (46.9)	+26.2 (+56.6)	-41.65 (-2.7)	-40.0	9,700 mf 75vdc	500 mf 75vdc	0.22 mf 80vdc	NOT USED	5.6 mf 250vdc	NOT USED	36487
LQ533	67.8 (64.6)	+32.1 (+79.5)	-62.2 (-3.6)	-60.0	4,800 mf -10 +75% 110vdc	320 mf 110vdc	0.068 mf 400vdc	NOT USED	5.6 mf 250vdc	NOT USED	35902
LQ534	130.2 (124.2)	+61.1 (+161.6)	-120.5 (-0.91)	-120.0	2,600 mf -10 +75% 200vdc	170 mf 200vdc	0.068 mf 400vdc	NOT USED	3.3 mf 250vdc	NOT USED	35902

*LAMBDA PART NUMBER

TABLE I (Cont)

Model	Schematic Components									
	R1	R3	R4-R9	R10	R11	R108	R109	R115	R340	R342
LQ530	10,000	0.45 15W	0.43 ±5% 7W	135	82 ±5%	1050 ±0.5%	40.2K	1.8K	40.2K	10K
LQ531	20,000 ±10%	0.070 15W	0.74 ±5% 5W	135	182	562	40.2K	4.3K ±5%	JUMPER	10K
LQ532	40,000	0.12 10W	1.36	300	390 ±2%	280	40.2K	1.3K ±5%	JUMPER	20K
LQ533	60,000	0.16 5W	2.0	750	562	332	95.3K	27K	JUMPER	20K
LQ534	100,000	0.3	0.7	NOT	174K	NOT	22.6K			

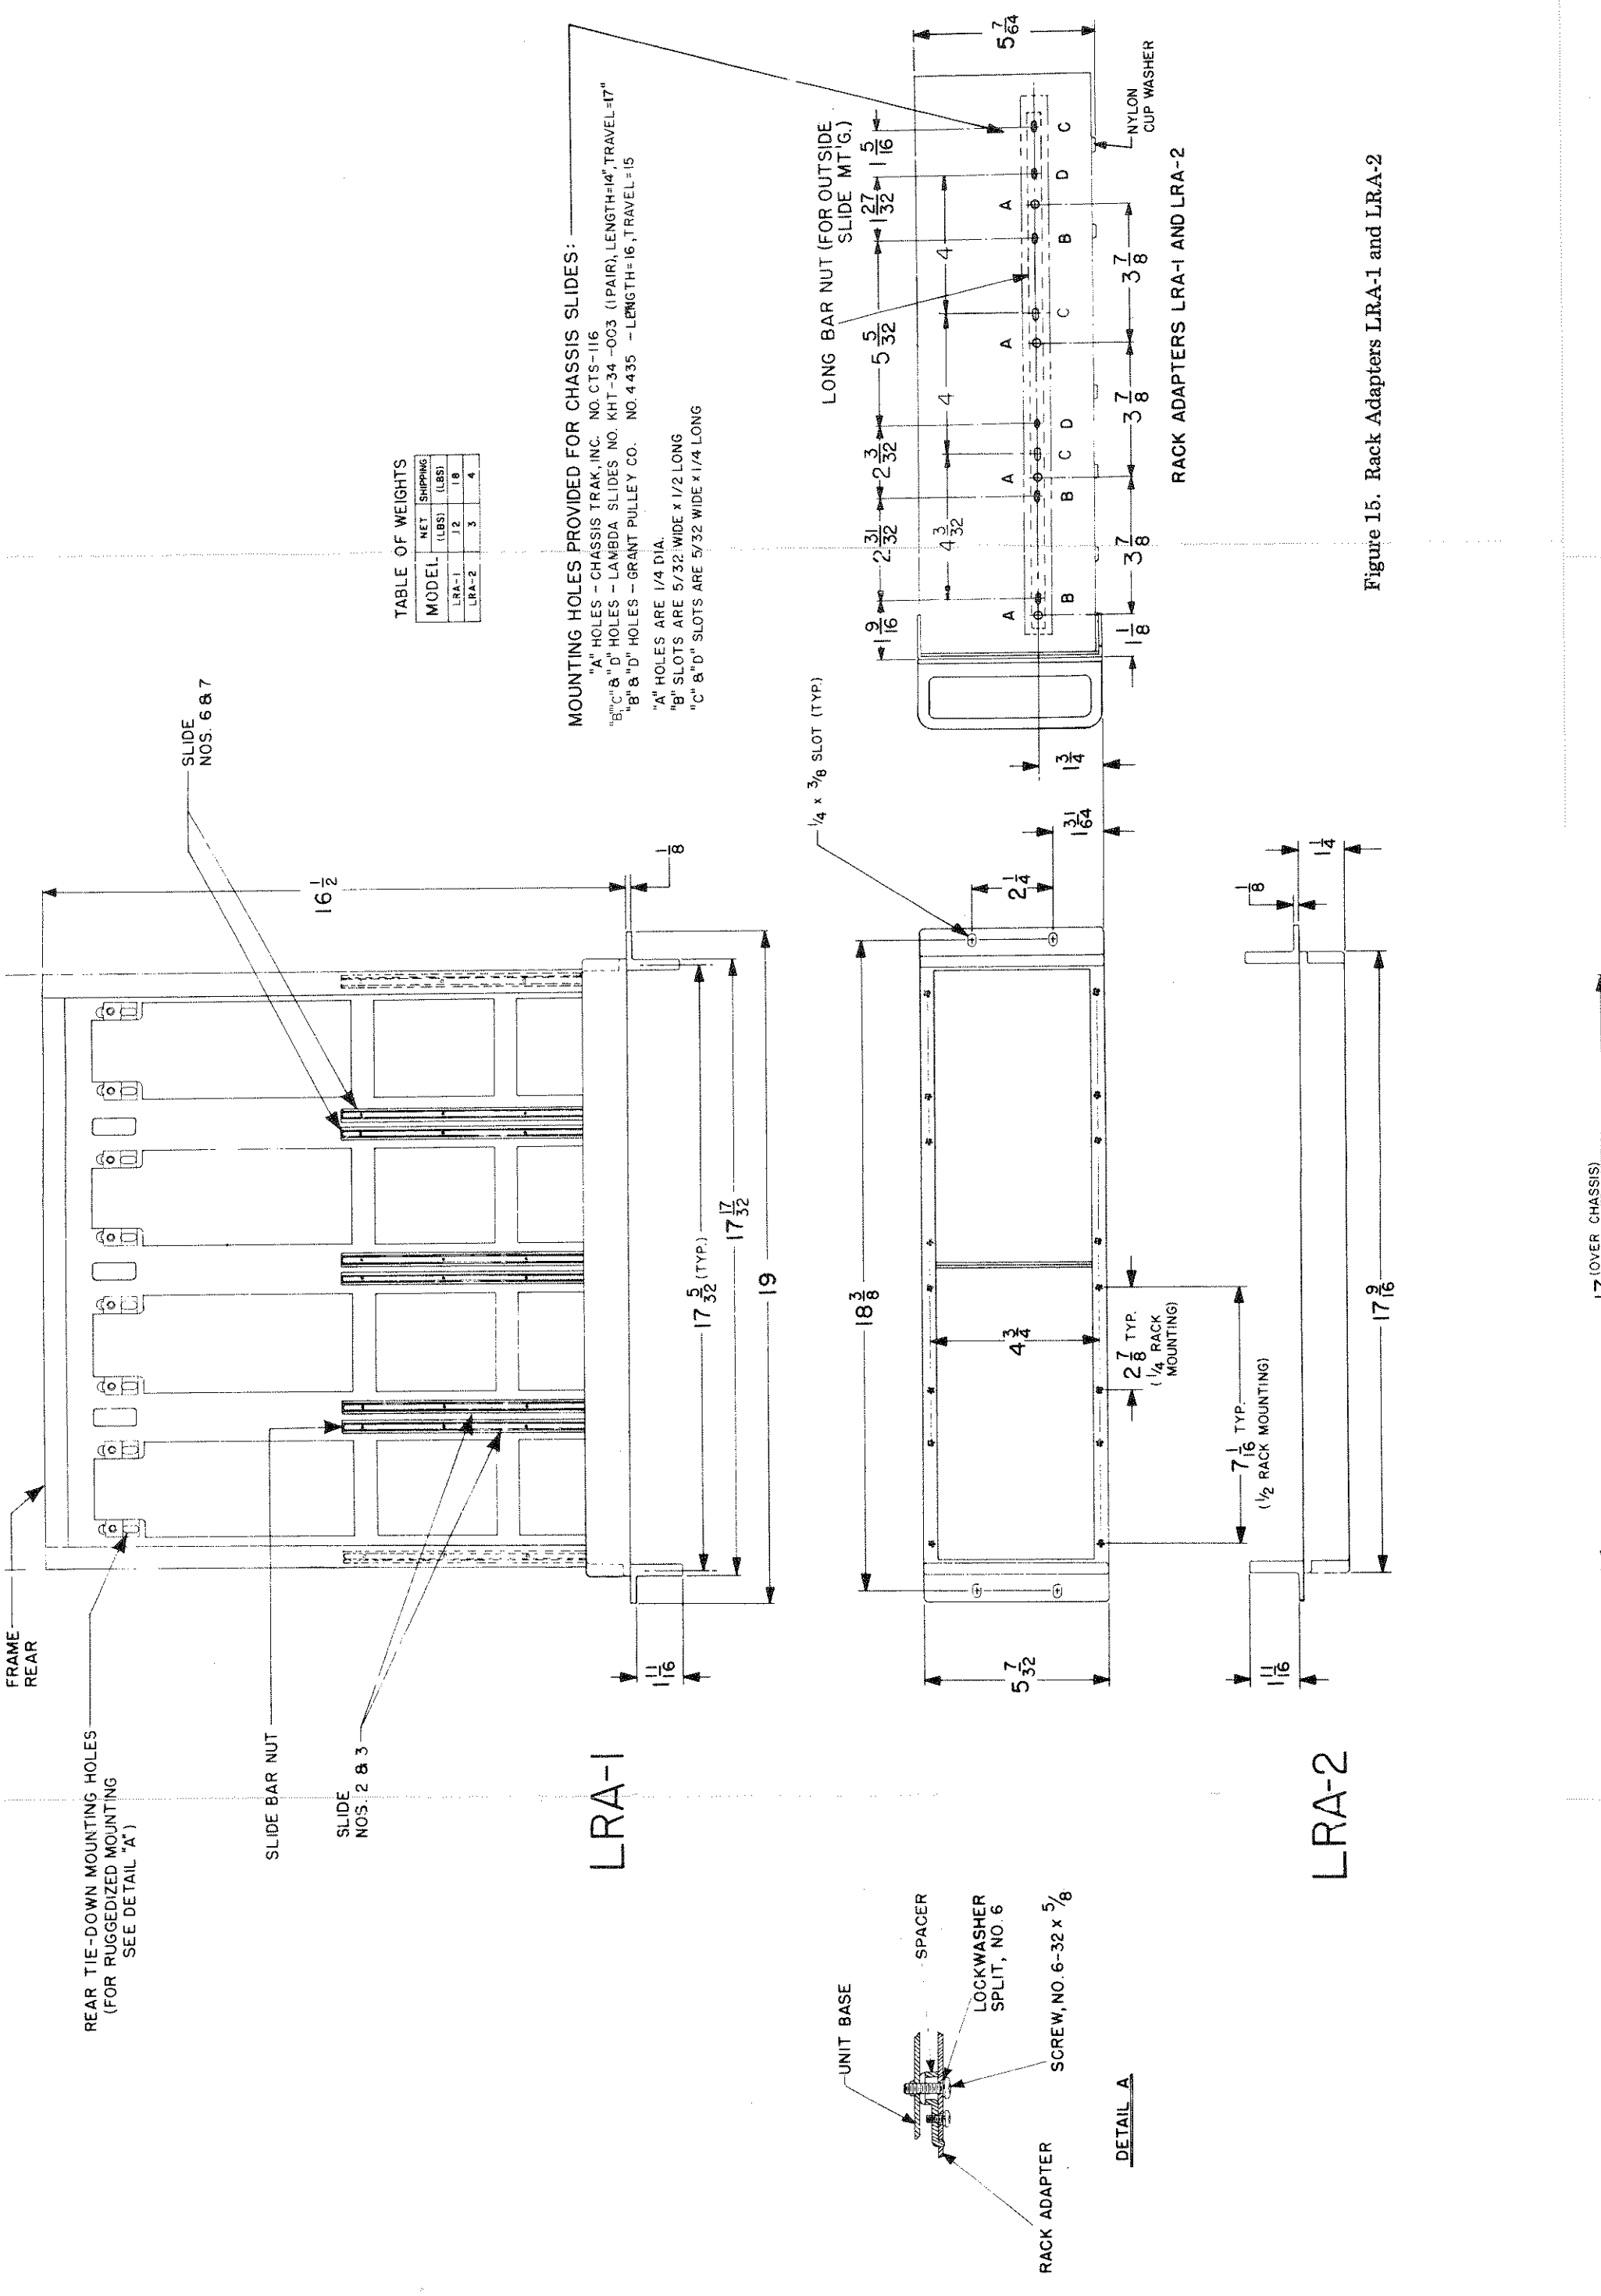


TABLE OF WEIGHTS


MODEL	NET (LBS)	SHIPPING (LBS)
LRA-1	12	18
LRA-2	3	4

MOUNTING HOLES PROVIDED FOR CHASSIS SLIDES:

"A" HOLES - CHASSIS TRAK, INC. NO. CTS-116
 "B", "C" & "D" HOLES - LAMBDA SLIDES NO. KHT-34 -003 (1 PAIR), LENGTH=14", TRAVEL=17"
 "B" & "D" HOLES - GRANT PULLEY CO. NO. 4435 - LENGTH=16", TRAVEL=15"
 "A" HOLES ARE 1/4 DIA.
 "B" SLOTS ARE 5/32" WIDE X 1/2" LONG
 "C" & "D" SLOTS ARE 5/32" WIDE X 1/4" LONG

Figure 15. Rack Adapters LRA-1 and LRA-2

17" (OVER CHASSIS)

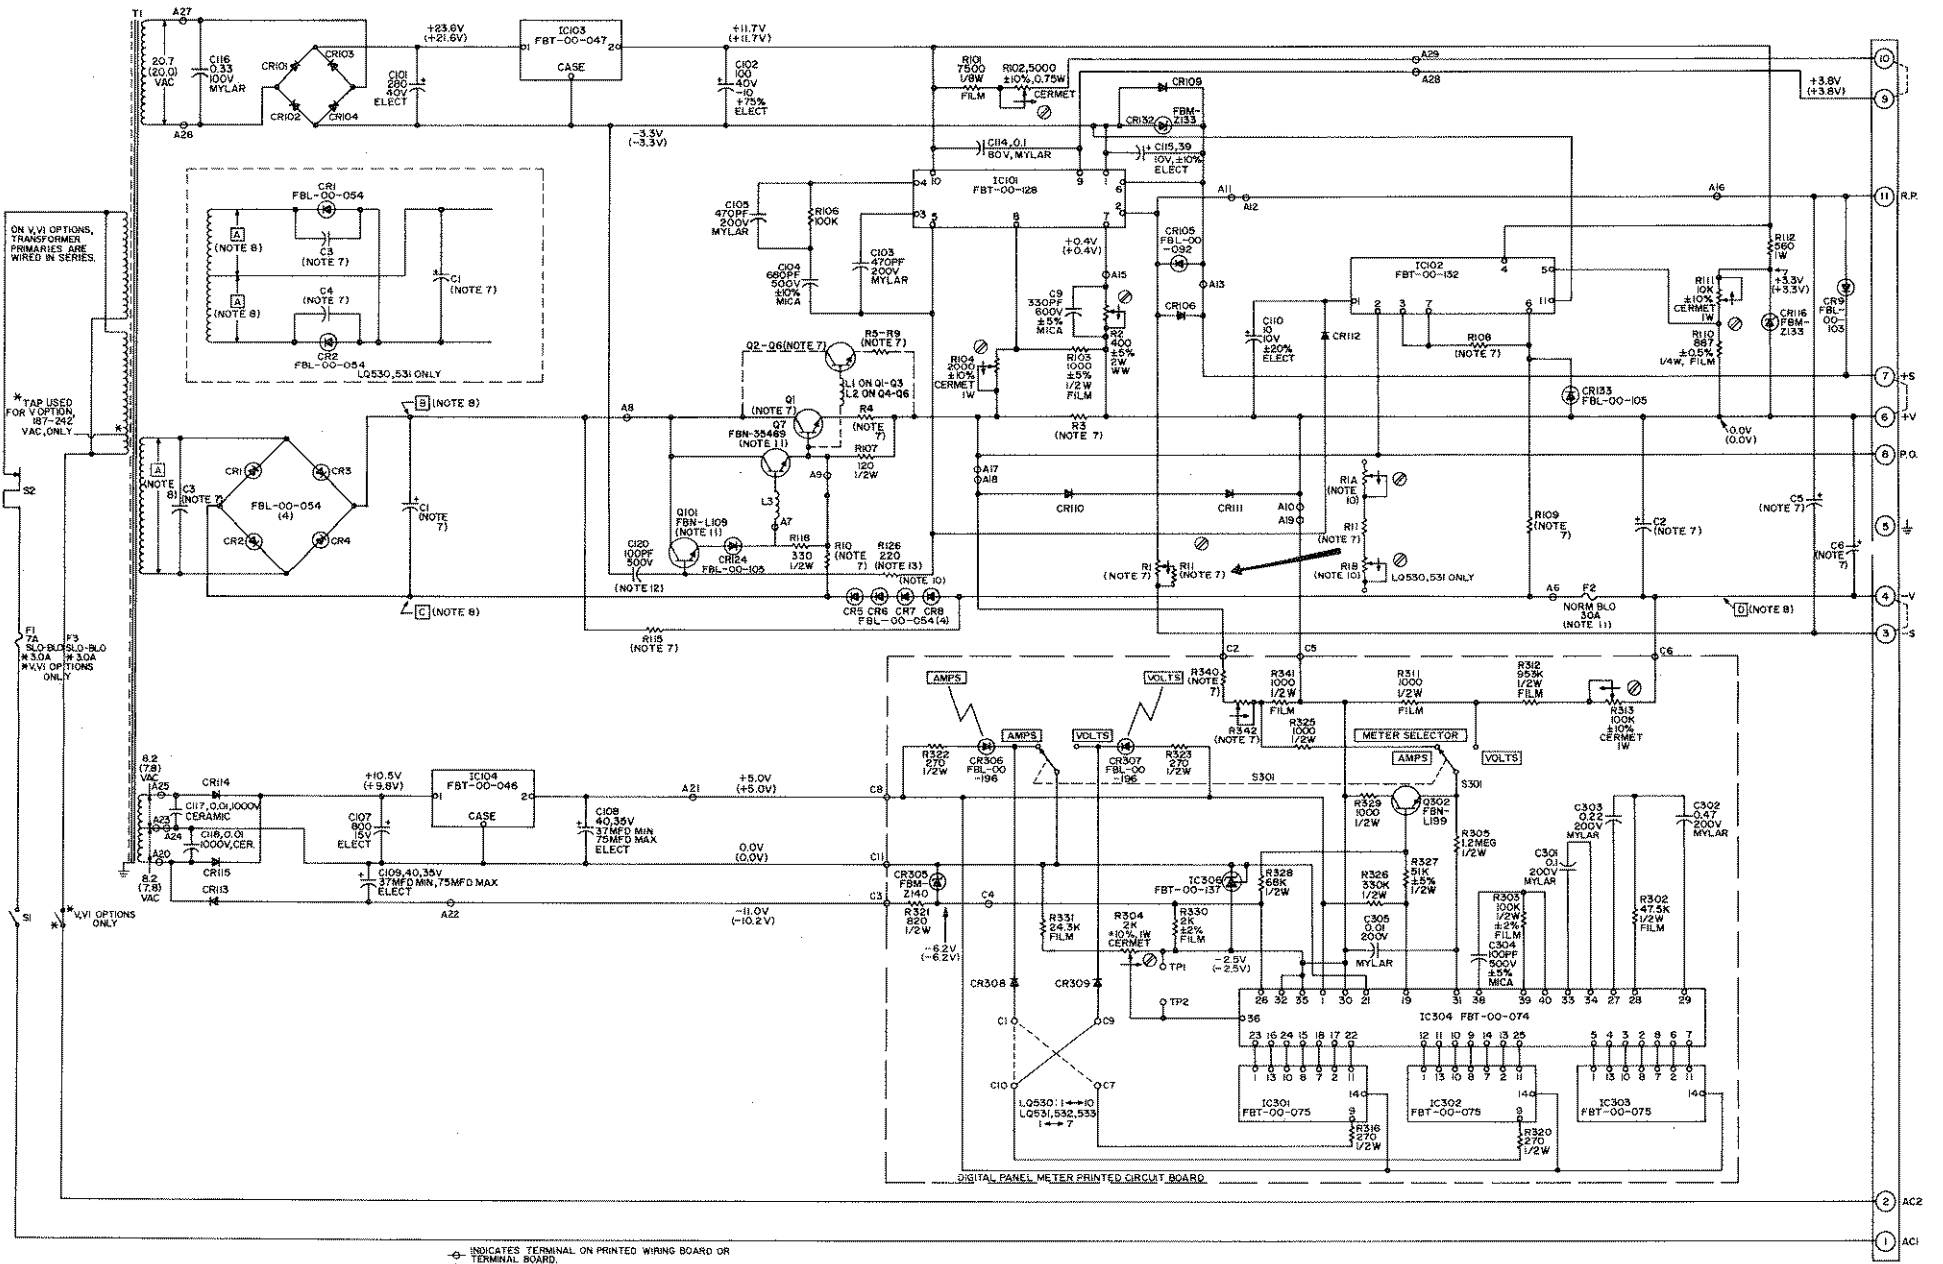


- NOTES
1. RESISTORS ARE 1/4W COMP. WITH VALUES IN OHMS UNLESS OTHERWISE NOTED.
 2. CAPACITOR VALUES ARE IN MICROFARADS UNLESS OTHERWISE NOTED.
 3. RESISTOR TOLERANCES: COMP. ±10%, FILM ±1%, WIREWOUND ±5% UNLESS OTHERWISE NOTED.
 4. CAPACITOR TOLERANCES: ELECTROLYTIC -10%+100%, CERAMIC ±20%, MYLAR ±10% UNLESS OTHERWISE NOTED.
 5. SYMBOLS:
 - INDICATES ACTUAL UNIT MARKING
 - ⊙ INDICATES CLOCKWISE ROTATION OF SHAFT
 - ⊛ SEE INSTRUCTION MANUAL
 - ⊛ LAMBDA PART NO. FBL-00-030 USE IN 4002 DIODE FOR REPLACEMENT UNLESS OTHERWISE NOTED.

6. INDICATES TERMINAL ON PRINTED WIRING BOARD OR TERMINAL BOARD.
7. INDICATES ADJUSTMENT OR CALIBRATION CONTROL.
8. DESIGNATIONS ARE LAMBDA PART NUMBERS.
9. SEE TABLE 1 FOR COMPONENT VALUES.
10. SEE TABLE 1 FOR VOLTAGE VALUES.
11. CONDITIONS FOR CIRCUIT POINT MEASUREMENTS, CV AND CC.
12. INPUT: 115VAC, 60Hz.
13. INDICATED VOLTAGES ARE TYPICAL VALUES AND ARE DC UNLESS OTHERWISE NOTED. DC MEASUREMENTS TAKEN WITH 20,000 OHMS/VOLTS VOLTMETER BETWEEN +5 (TERM 7) AND INDICATED POINTS UNLESS NOTED OTHERWISE.
14. CONSTANT VOLTAGE
READ NOS. NOT IN PARENTHESIS
OUTPUT: MAX. RATED VOLTAGE, ZERO CURRENT.

15. CONSTANT CURRENT
READ NOS. IN PARENTHESIS
OUTPUT: 0 VOLTS, MAX. RATED CURRENT (SHORT CIRCUIT).
16. CR1, CR2 ONLY USED ON LQ532 AND LQ531. CR3 ONLY USED ON LQ533. R1A, R1B IS 1/2W ON LQ530 AND IS 1/4W ON LQ531.
17. CR10 IS FBM-1108 ON LQ532 AND LQ533; CR11 IS FBM-36488 ON LQ531 AND IS FBM-35903 ON LQ532; CR12 IS 20A ON LQ531, 10A ON LQ532 AND 7A ON LQ533.
18. CR13 ONLY USED ON LQ531 UNITS.
19. R126 IS 1K OHM ON LQ531 UNITS.

FOR WIRING OF POWER SUPPLY TO LOAD REFER TO SUPPLY-TO-LOAD WIRING DIAGRAMS.
DOTTED CONNECTIONS SHOWN ON TBI INDICATE JUMPERS IN PLACE FOR LOCAL SENSING CONNECTION.
THIS SCHEMATIC APPLIES TO UNITS BEARING SERIAL NO. PREFIXES 3 & 8.

SCHEMATIC DIAGRAM
REGULATED POWER SUPPLY
LQ530, LQ531
LQ532, LQ533
LAMBDA
ELECTRONICS
MELVILLE, NEW YORK
DIVISION OF **VACO** INSTRUMENTS INC.

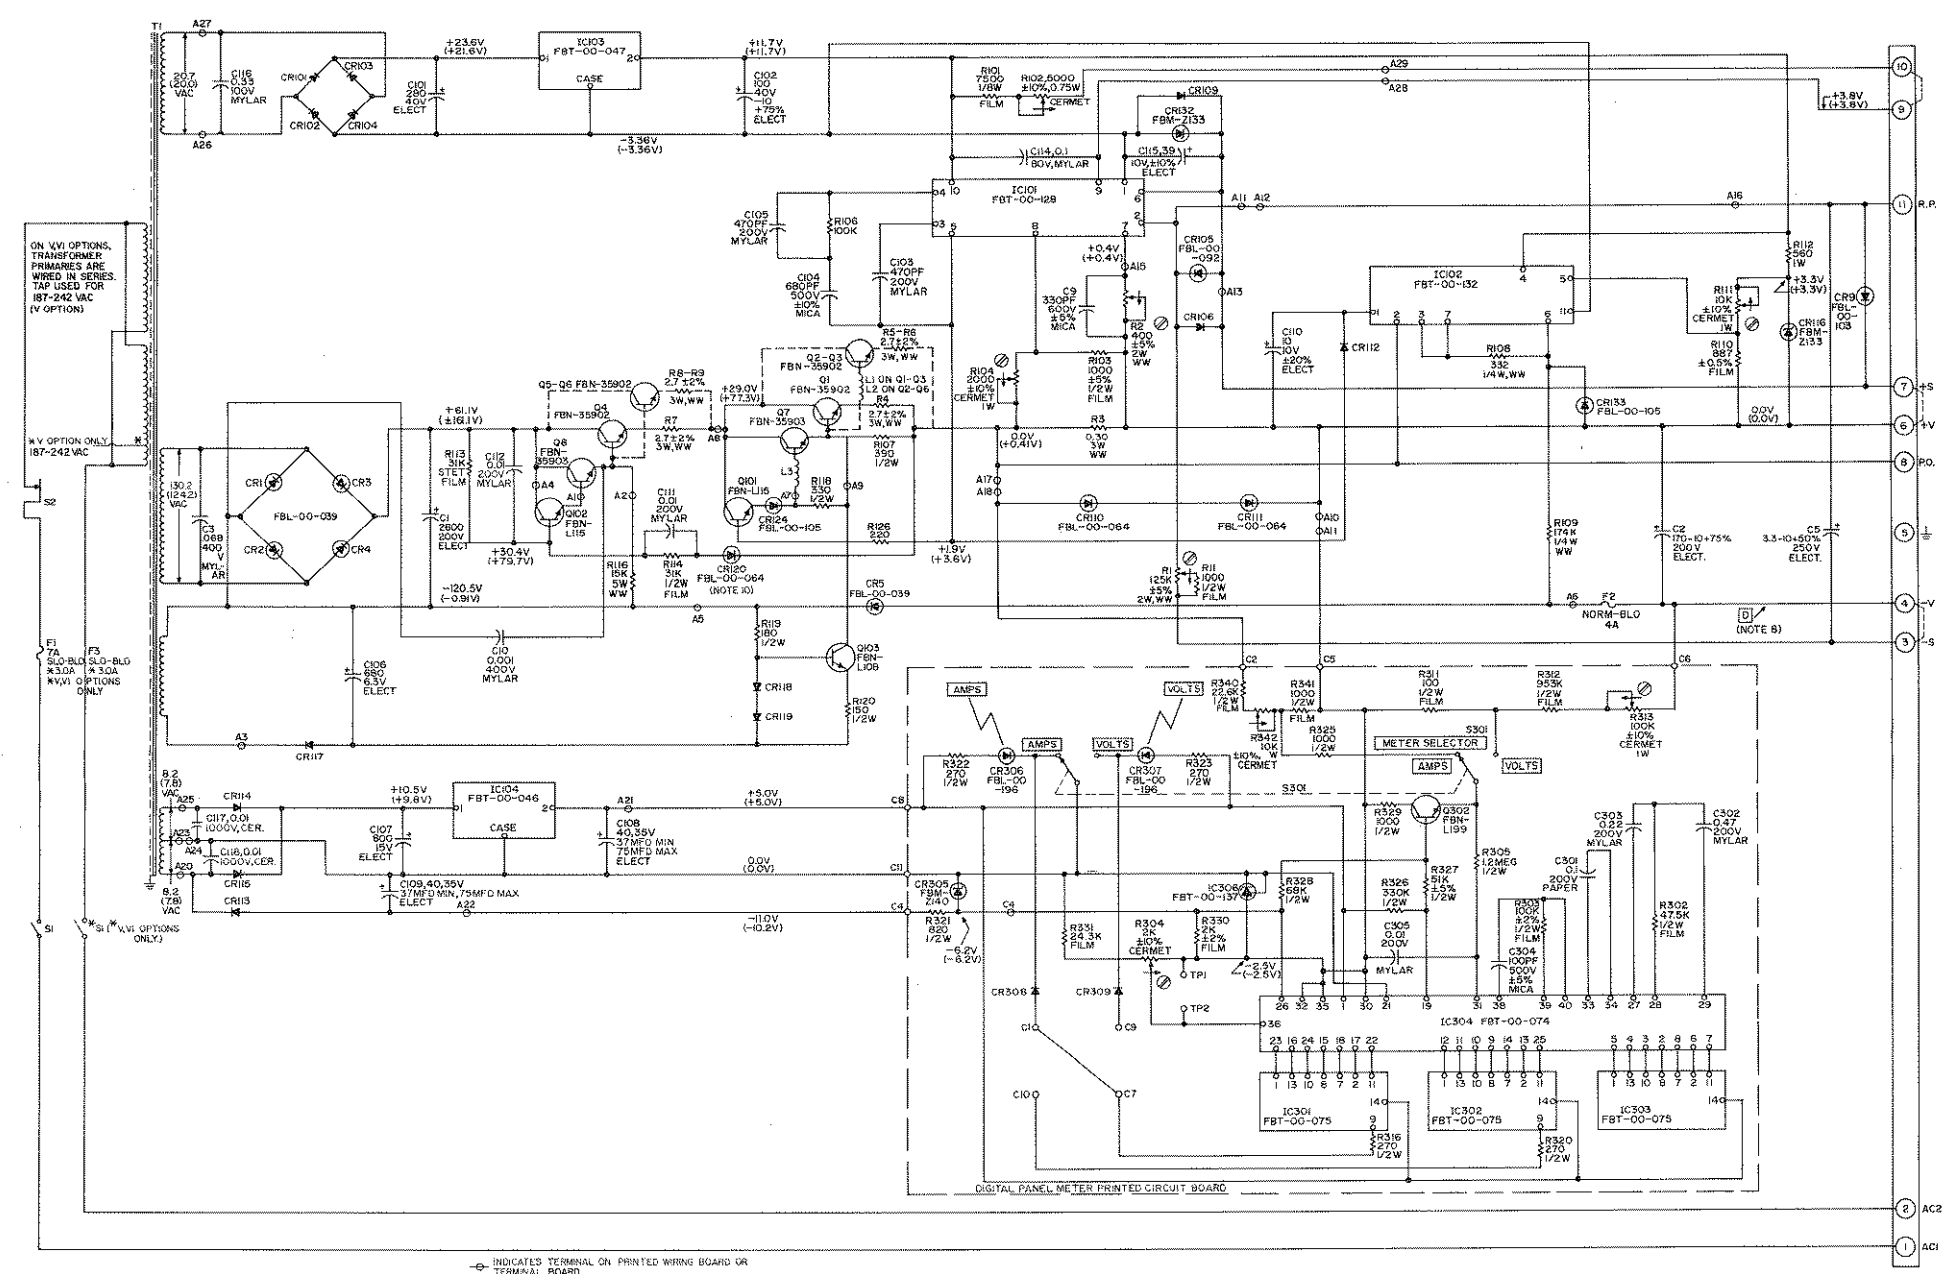

- NOTES
1. RESISTORS ARE 1/4W COMP. WITH VALUES IN OHMS UNLESS OTHERWISE NOTED.
 2. CAPACITOR VALUES ARE IN MICROFARADS UNLESS OTHERWISE NOTED.
 3. RESISTOR TOLERANCES: COMP. ±10%, FILM ±1%, WIREWOUND ±5% UNLESS OTHERWISE NOTED.
 4. CAPACITOR TOLERANCES: ELECTROLYTIC -10%+100%, CERAMIC ±20%, MYLAR ±10% UNLESS OTHERWISE NOTED.
 5. SYMBOLS:
 - INDICATES ACTUAL UNIT MARKING
 - ⊙ INDICATES CLOCKWISE ROTATION OF SHAFT
 - ⊛ SEE INSTRUCTION MANUAL
 - ⊛ LAMBDA PART NO. FBL-00-030 USE IN 4002 DIODE FOR REPLACEMENT UNLESS OTHERWISE NOTED.

6. INDICATES TERMINAL ON PRINTED WIRING BOARD OR TERMINAL BOARD.
7. INDICATES ADJUSTMENT OR CALIBRATION CONTROL.
8. DESIGNATIONS ARE LAMBDA PART NUMBERS.
9. SEE TABLE 1 FOR COMPONENT VALUES.
10. SEE TABLE 1 FOR VOLTAGE VALUES.
11. CONDITIONS FOR CIRCUIT POINT MEASUREMENTS, CV AND CC.
12. INPUT: 115VAC, 60Hz.
13. INDICATED VOLTAGES ARE TYPICAL VALUES AND ARE DC UNLESS OTHERWISE NOTED. DC MEASUREMENTS TAKEN WITH 20,000 OHMS/VOLTS VOLTMETER BETWEEN +5 (TERM 7) AND INDICATED POINTS UNLESS NOTED OTHERWISE.
14. CONSTANT VOLTAGE
READ NOS. NOT IN PARENTHESIS
OUTPUT: MAX. RATED VOLTAGE, ZERO CURRENT.

15. CONSTANT CURRENT
READ NOS. IN PARENTHESIS
OUTPUT: 0 VOLTS, MAX. RATED CURRENT (SHORT CIRCUIT).
16. CR12 ONLY USED ON UNITS WITH SERIAL NO. PREFIX K.

FOR WIRING OF POWER SUPPLY TO LOAD REFER TO SUPPLY-TO-LOAD WIRING DIAGRAMS.
DOTTED CONNECTIONS SHOWN ON TBI INDICATE JUMPERS IN PLACE FOR LOCAL SENSING CONNECTION.
THIS SCHEMATIC APPLIES TO UNITS BEARING SERIAL NO. PREFIXES 3 & 8.

SCHEMATIC DIAGRAM
REGULATED POWER SUPPLY
LQ534
LAMBDA
ELECTRONICS
MELVILLE, NEW YORK
DIVISION OF **VACO** INSTRUMENTS INC.